


WAAS CH 42913 W06A	APP CRS 061°	Rwy Idg 10900 TDZE 998 Apt Elev 1009
--	------------------------	---

RNAV (GPS) Z RWY 6L

JAMES M COX DAYTON INTL (DAY)

RNP APCH.		ALSIF-2 	MISSED APPROACH: Climb to 3000 direct HEGUK and on track 331° to ICASI and on track 270° to DQN VOR/DME and hold.	
Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. Use of FD or AP required during simultaneous operations. For inop ALS, increase LNAV/VNAV all Cats visibility to RVR 5500 and LNAV Cats C/D to 1¼ SM.				
ATIS 125.8	COLUMBUS APP CON 134.45 323.15	DAYTON TOWER 119.9 257.7	GND CON 121.9	CLNC DEL 121.75

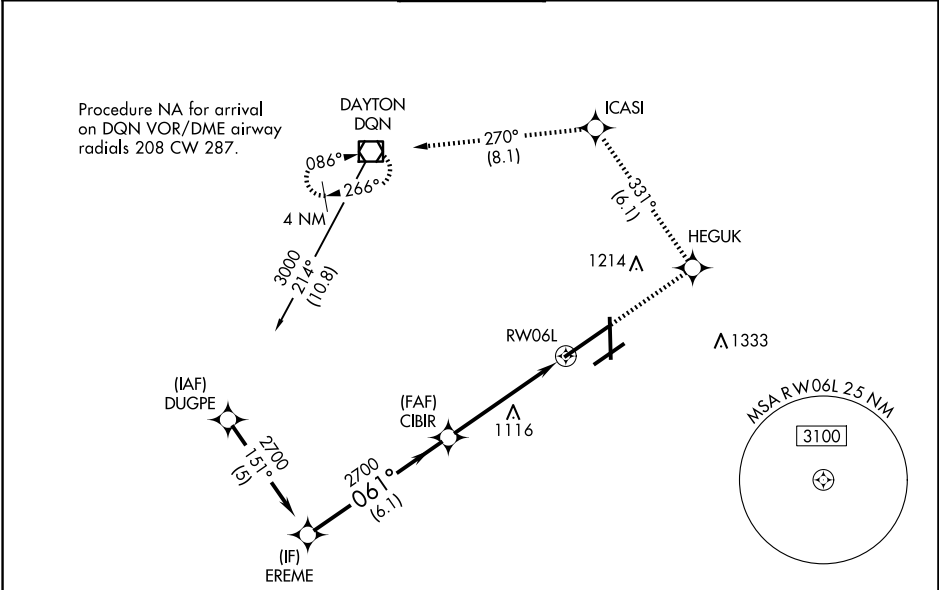

VGSi and RNAV glidepath not coincident (VGSi Angle 3.00°/TCH 67°).					ELEV 1009		D		TDZE 998							
					3000 ↑		HEGUK ✦		tr 331°		ICASI ✦		tr 270°		DQNN ◼	
															*LNAV only.	
CATEGORY					A		B		C		D					
LPV DA					1198/18		200 (200-½)									
LNAV/ VNAV DA					1366/40		368 (400-¾)									
LNAV MDA					1420/24		422 (500-½)		1420/40 422 (500-¾)		1420/50 422 (500-1)					
C CIRCLING					1580-1		571 (600-1)		1580-1½ 571 (600-1½)		1640-2 631 (700-2)					

HIRL all Rwy's
TDZ/CL Rwy 6L
REIL Rwy's 6R and 36