

LOC/DME I-JRT 108.5 Chan 22	APP CRS 187°	Rwy Ldg 11002 TDZE 21 Apt Elev 26
---	------------------------	--

ILS or LOC RWY 19R
TAMPA INTL (TPA)

DME or RADAR required.




Simultaneous approach authorized. For inop ALS, increase S-ILS 19R Cat E visibility to RVR 4000 and S-LOC 19R Cats C/D/E visibility to RVR 5500.

*RVR 1800 authorized with use of FD or AP or HUD to DA.

MALS R

MISSED APPROACH: Climb to 500 then climbing right turn to 2000 direct PIE VORTAC and hold, continue climb-in-hold 2000. (TACAN aircraft climb to 500 then climbing right turn to 2000 direct PIE VORTAC then on PIE VORTAC R-276 to LAFAL INT/PIE 8 DME and hold W, RT, 096° inbound.)

ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

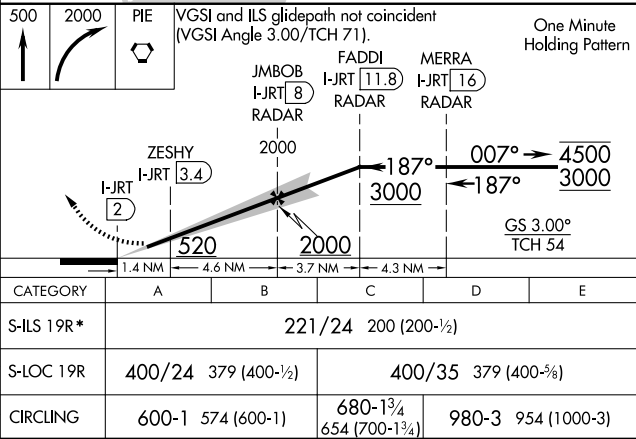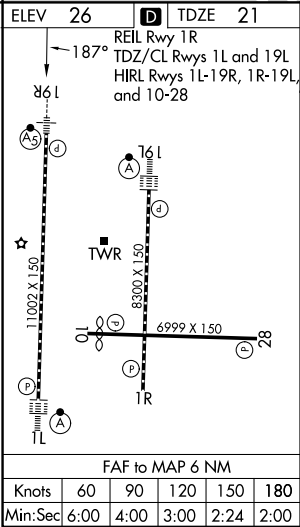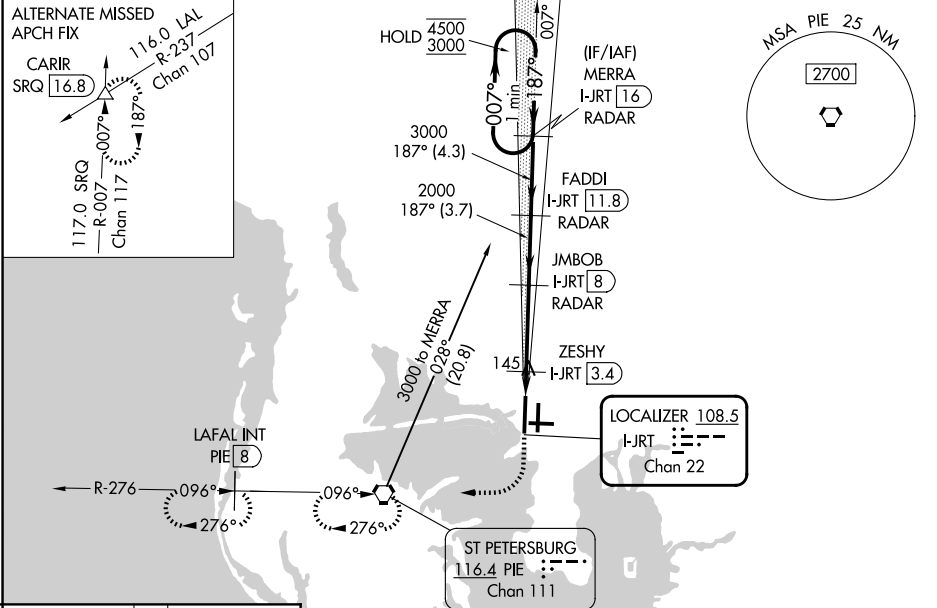

SE-3, 04 SEP 2025 to 02 OCT 2025

SE-3, 04 SEP 2025 to 02 OCT 2025