



LOC/DME I-DMP 111.7 Chan 54	APP CRS 234°	Rwy Ldg TDZE Apt Elev 10000 409 435	ILS RWY 23R (CAT II & III) RALEIGH-DURHAM INTL (RDU)	
---	------------------------	---	--	--

RNAV 1-DME/DME/IRU or GPS or RADAR required for procedure entry.	ALSF-2 	MISSED APPROACH: Climb to 1000 then climbing right turn to 2200 on RDU VORTAC R-356 to DUHAM INT/RDU 11 DME and hold.
Simultaneous approach authorized.		

D-ATIS 123.8	RALEIGH APP CON 127.675 307.9	RALEIGH TOWER 127.45 257.8	GND CON 121.9 348.6	CLNC DEL 120.1	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

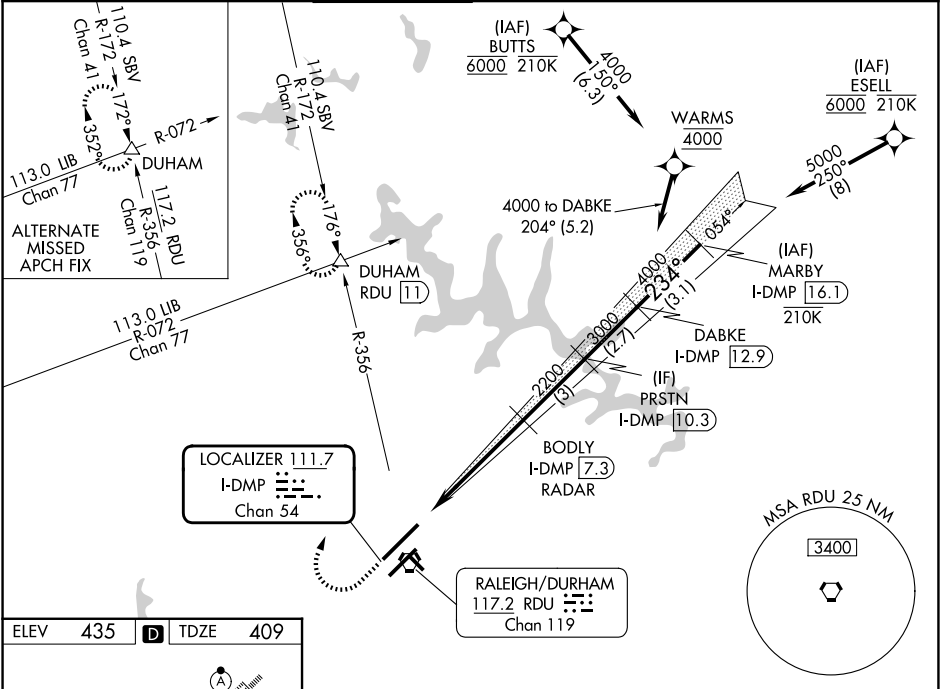

ELEV 435	D	TDZE 409
----------	---	----------

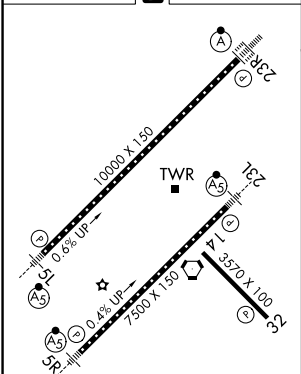

REIL Rwy 32
MIRL Rwy 14-32
HIRL Rws 5R-23L and 5L-23R
TDZ/CL Rws 23R, 23L and 5L

1000	2200	RDU R-356	DUHAM	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 69).
CATEGORY	A	B	C	D
S-ILS 23R	CAT II RA 105/12 100 DA 509			
S-ILS 23R	CAT III RVR 06			

CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED