


WAAS CH 50244 W31A	APP CRS 300°	Rwy Ldg TDZE Apt Elev 8500 429 476
--	------------------------	--

RNAV (GPS) Z RWY 31L

PALM SPRINGS INTL (PSP)

RNP APCH-GPS.		MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. *Missed approach requires minimum climb of 355 feet per NM to 2100.			
⚠ Circling NA southwest of Rwy 13R-31L.					
ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER* 119.7 (CTAF) 377.05	GND CON 121.9	CLNC DEL 128.35	UNICOM 122.95

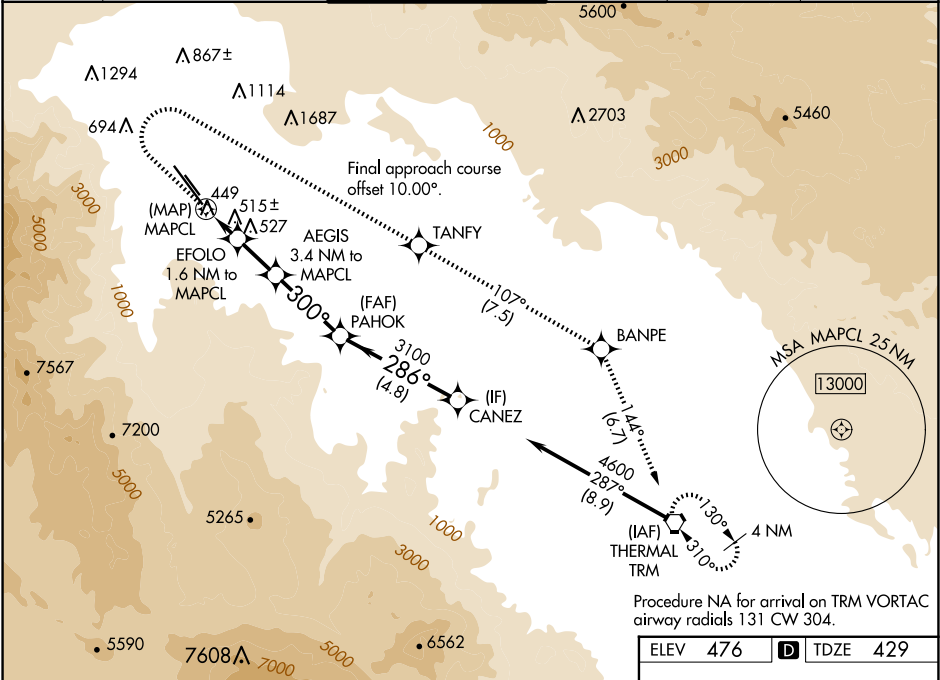

ELEV 476	TDZE 429
----------	----------

900 4000 TANFY tr 107° BANPE tr 144° TRM		CANEZ	
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55).		PAHOK	
MAPCL 1220 1920		3100 4600	
MAPCL 1220 1920		3100 4600	
CATEGORY A B C D			
LP MDA 700-1 271 (300-1) 780-1 351 (400-1) 1320-2½ 891 (900-2½)			
LNAV MDA* 780-1 351 (400-1)			
LNAV MDA 920-1 491 (500-1) 1180-1¼ 751 (800-1¼) 1440-3 1011 (1000-3)			
CIRCLING 920-1 444 (500-1) 1180-1¼ 704 (800-1¼) 1440-3 1760-3 1284 (1300-3)			

