


ILS or LOC RWY 18R
ORLANDO INTL (MCO)


MALSR

MISSED APPROACH: Climb to 500 then climbing right turn to 4000 on heading 270° and on ORL VORTAC R-227 to CAMBE INT/ORL 20 DME and hold, continue climb-in-hold to 4000.

T Simultaneous approach authorized.

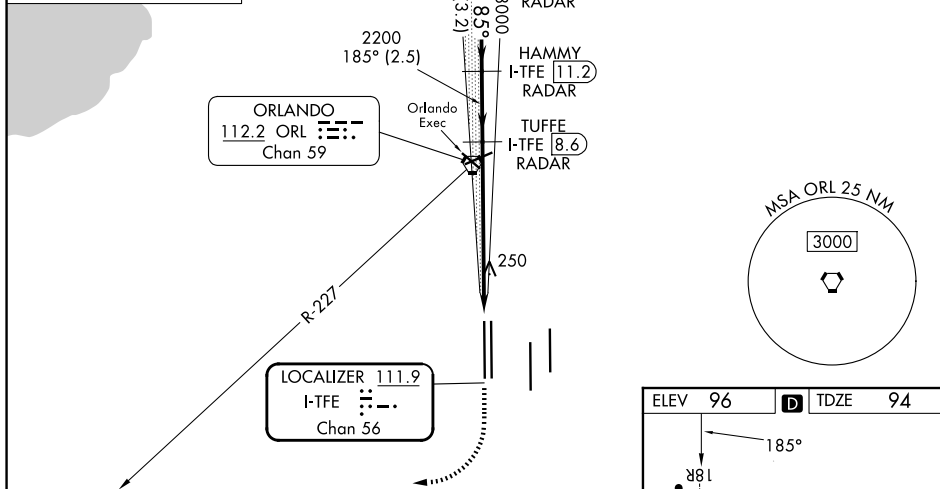

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 71).

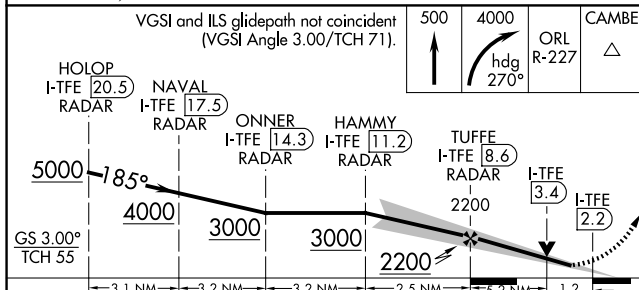

ELEV	96	D	TDZE	94	
HIRL all Rwys REIL Rwy 36L TDZ/CL Rwy 17L/R, 18R, 35L/R, and 36R					
FAF to MAP 6.4 NM					
Knots	60	90	120	150	180
Min:Sec	6:24	4:16	3:12	2:34	2:08

ILS or LOC RWY 18R

SE-3, 04 SEP 2025 to 02 OCT 2025