

APP CRS	Rwy ldg	9800
259°	TDZE	38
	Apt Elev	38

RNAV (GPS) RWY 26

HILO INTL (ITO) (PHTO)

RNP APCH.

▼


⚠

Circling NA south of Rwy 8-26. Rwy 26 helicopter visibility reduction below $\frac{3}{4}$ SM NA. WAAS VNAV NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to $\frac{3}{8}$ SM and increase LNAV Cat A/B visibility to 1 SM.


MALSR

MISSED APPROACH: Climb to 500 then climbing right turn to 4000 direct CABIX and hold, continue climb-in-hold to 4000.

ATIS 126.4	HILO APP CON* 119.7 269.2	HILO TOWER* 118.1(CTAF) 0 263.1	GND CON 121.9
---------------	------------------------------	------------------------------------	------------------

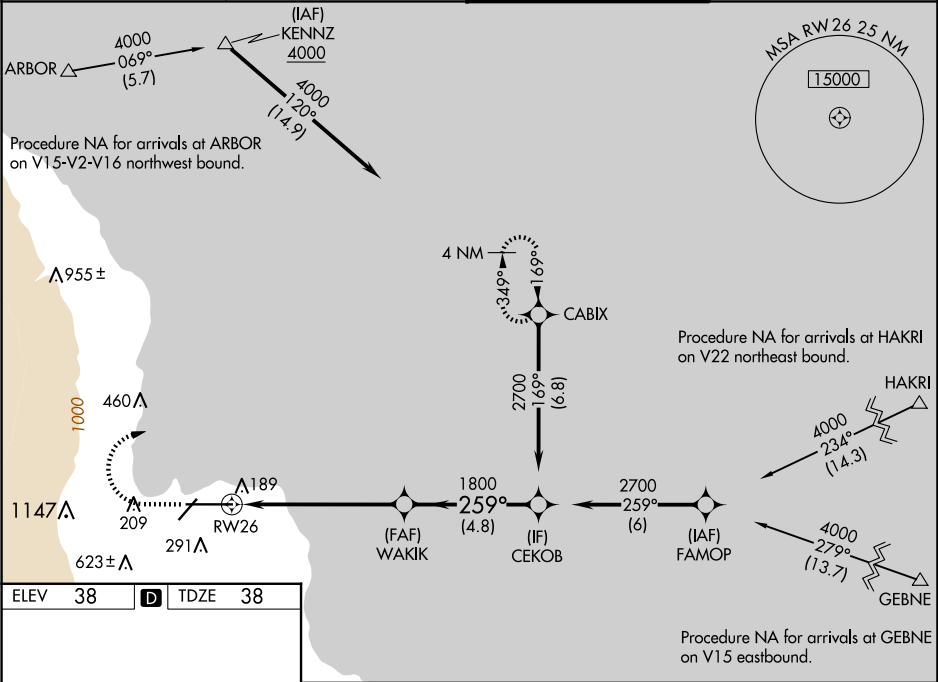

ELEV	38	D	TDZE	38
------	----	---	------	----

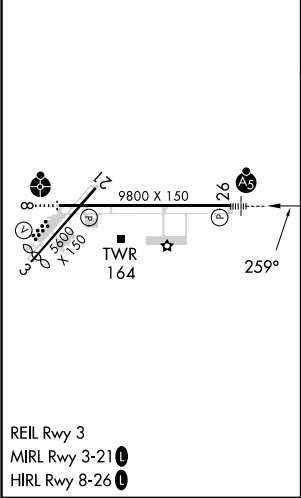

500	4000	CABIX	VGSI and RNAV glidepath not coincident (VGSI Angle 2.60/TCH 70).			
*LNAV only						
CATEGORY	A	B	C	D		
LNAV/ VNAV DA	350-¾ 312 (400-¾)					
LNAV MDA	460-¾ 422 (500-¾)					
CIRCLING	500-1	540-1	840-2¼	1320-3		
	462 (500-1)	502 (600-1)	802 (900-2¼)	1282 (1300-3)		