



WAAS CH 47267 W34A	APP CRS 341°	Rwy Idg TDZE 131 Apt Elev 143
--	------------------------	---

RNAV (GPS) RWY 34

MERRILL FLD (MRI) (PAMR)

RNP APCH - GPS.	MISSED APPROACH: Climbing left turn to 2000 direct BQG VORTAC and hold.
RADAR required for procedure entry.	
When local altimeter setting not received, use Ted Stevens Anchorage Intl altimeter setting and increase all MDAs 20 feet. Procedure NA at night. Helicopter visibility reduction below 1 SM NA.	

ATIS 124.25	ANCHORAGE APP CON 119.1 363.2	MERRILL TOWER * 126.0 (CTAF) 0	GND CON 121.7	UNICOM 122.95
-----------------------	---	--	-------------------------	-------------------------

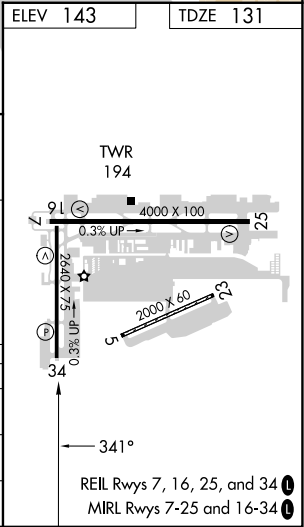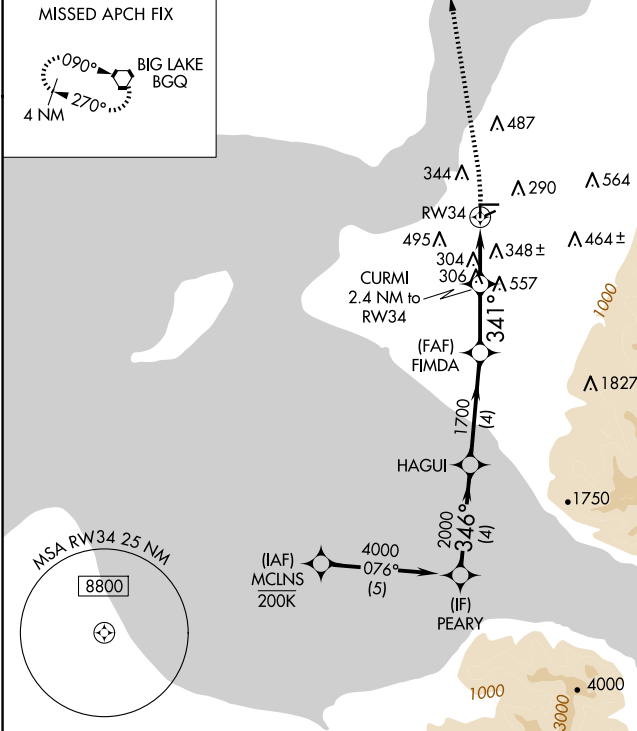

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 21).				
PEARY	HAGUI	FIMDA	CURMI	RW34
4000	2000	1700	900	
346°	341°	341°	341°	
4 NM	4 NM	2.5 NM	2.4 NM	
CATEGORY	A	B	C	D
LP MDA	560-1	429 (500-1)	NA	
LNAV MDA	600-1	469 (500-1)	NA	
CIRCLING	740-1 597 (600-1)	800-1 657 (700-1)	NA	

AK, 07 AUG 2025 to 02 OCT 2025

AK, 07 AUG 2025 to 02 OCT 2025