

TACAN Y RWY 32

TACAN EIL Chan 98	APCH CRS 320°	Rwy lgt 14,529 TDZE 548 Arpt Elev 548
----------------------	------------------	---

[USAF]

EIELSON AFB (PAEI)

ATC or RADAR required HRDNG to BOGIE. RNAV or RADAR monitoring required for missed approach.


▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE vis to 1½ miles.
** Circling not authorized E of Rwy 14-32.



MISSED APPROACH: Climbing left turn on EIL R-249 to 4000 to WAKOV and hold. Continue climb-in-hold.



ATIS ★ 119.9 273.5	FAIRBANKS APP CON 127.1 251.1 360°-179° 125.35 363.2 180°-359°	TOWER ★ 127.2 352.05	GND CON 121.8 275.8	CLNC DEL 343.7
-----------------------	--	-------------------------	------------------------	-------------------

CAUTION: Uncontrolled airspace below 700' AGL outside EIL CLASS D.

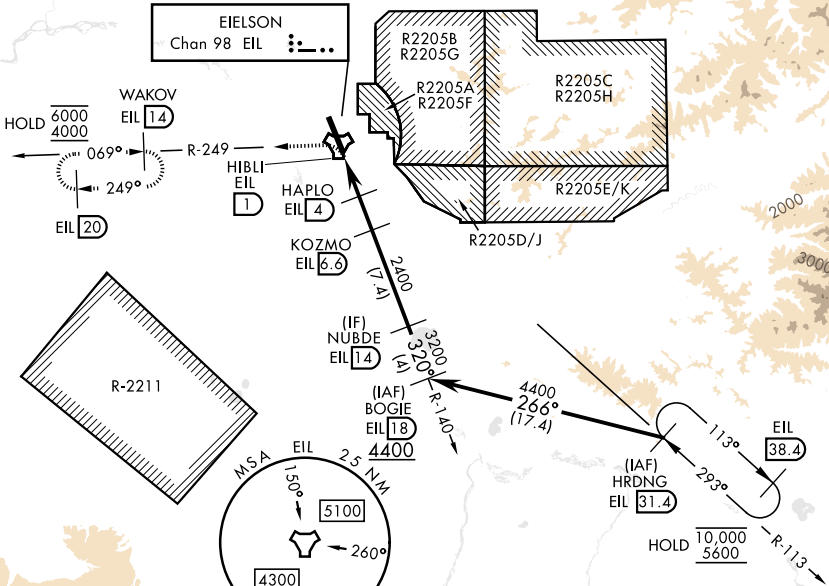

EMERG SAFE ALT 100 NM 16,000

ELEV 548	TDZE 548
----------	----------

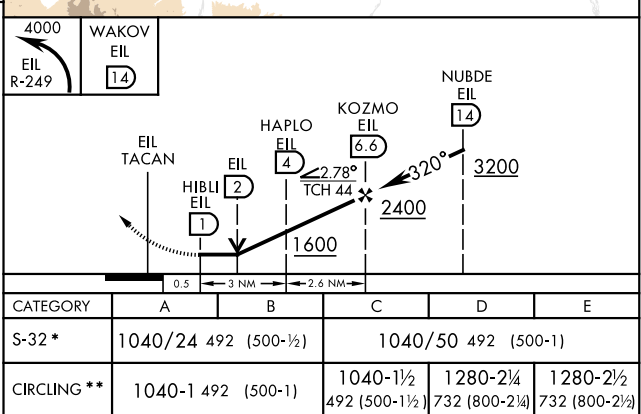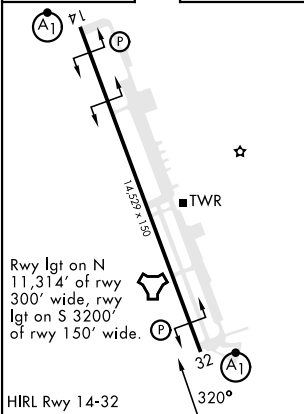

TACAN Y RWY 32

AK, 07 AUG 2025 to 02 OCT 2025

AK, 07 AUG 2025 to 02 OCT 2025