

VORTAC RQZ	APP CRS	Rwy Idg	5500
112.2	010°	TDZE	978
Chan 59		Apt Elev	984


VOR/DME RWY 2
FAYETTEVILLE MUNI (FYM)

⚠ **NA**


When local altimeter setting not received, use Huntsville Exec Tom Sharp Jr Fld altimeter setting and increase all MDA 120 feet; increase S-2 Cat C/D visibility ¼ SM, Circling Cat C visibility ½ SM, and Circling Cat D visibility ¼ SM. Rwy 2 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climb to 2000 then climbing left turn to 3000 via RQZ R-010 to JOYER INT and hold.

AWOS-3 135.275	HUNTSVILLE APP CON ★ 125.6 354.1	CLNC DEL (GCO) 121.725	UNICOM 122.8 (CTAF) 0
-------------------	-------------------------------------	---------------------------	---------------------------------

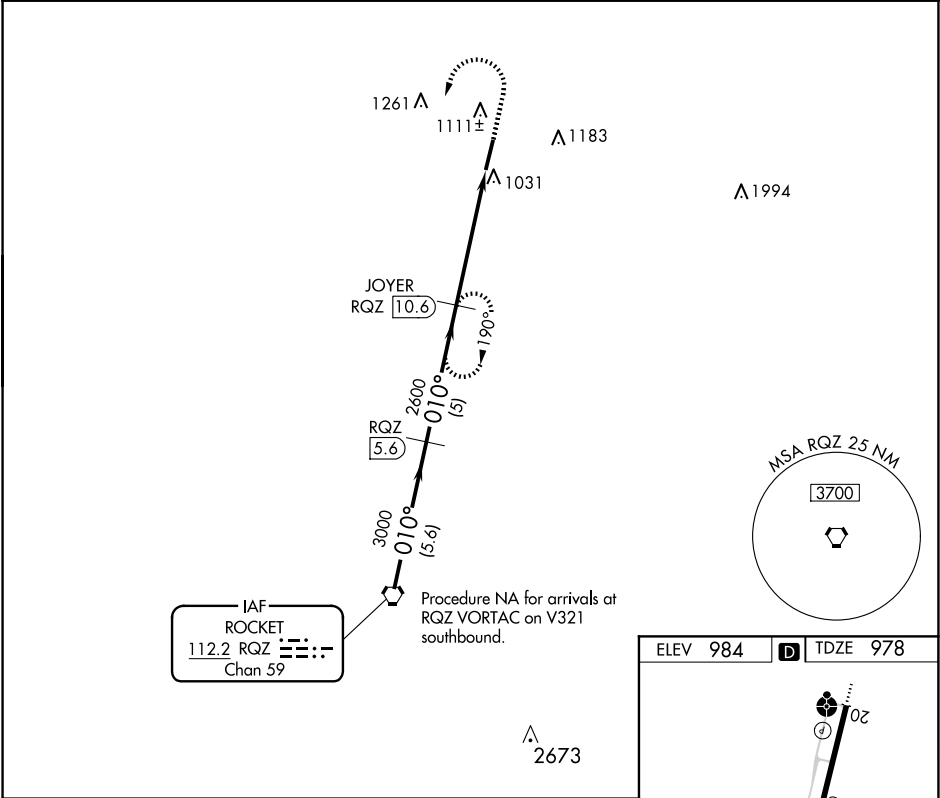

RQZ VORTAC		VGSI and descent angles not coincident (VGSI 3.00/TCH 22).		2000	3000	JOYER RQZ 10.6
4000		RQZ 5.6		RQZ R-010		
Procedure Turn NA		3000		RQZ 15.6		
010°		2600		3.00° TCH 40		
5.6 NM		5 NM		5 NM		
CATEGORY	A	B	C	D		
S-2	1400-1	422 (500-1)	1400-1½ 422 (500-1¼)	1400-1½ 422 (500-1½)		
CIRCLING	1420-1 436 (500-1)	1540-1 556 (600-1)	1580-1½ 596 (600-1½)	1580-2 596 (600-2)		

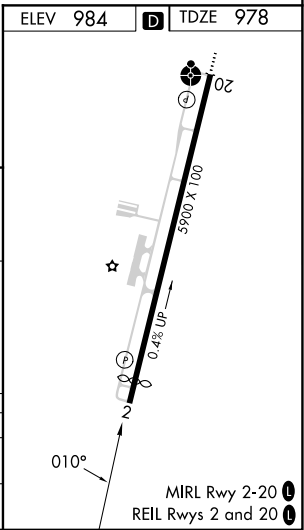

SE-1, 04 SEP 2025 to 02 OCT 2025

SE-1, 04 SEP 2025 to 02 OCT 2025