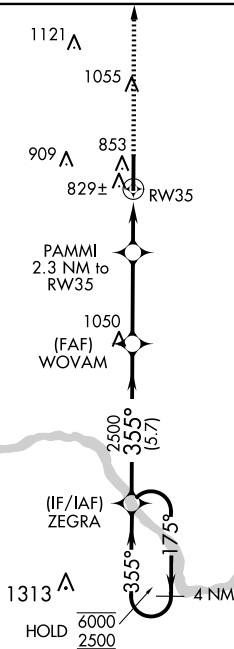
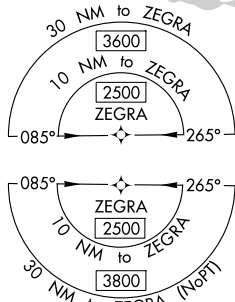
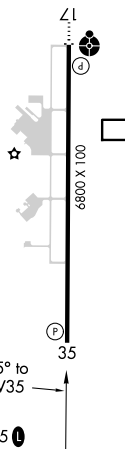


21336

RNAV (GPS) RWY 35
DURANT RGNL/EAKER FLD (DUA)

MISSED APPROACH: Climb to 2500 direct JETBI and hold.

UNICOM
123.05 (CTAF) **L**TDZE 694

2500	JETBI
	

*LNAV only.

4 NM
Holding Pattern

6000 ← 17
2500 33

GP 3.00°
TCH 42

CATEGORY	A	B	C	D
LPV DA	894- $\frac{3}{4}$ 200 (200- $\frac{3}{4}$)			NA
LNAV/ VNAV DA	1086-1 $\frac{1}{8}$ 392 (400-1 $\frac{1}{8}$)			NA
LNAV MDA	1080-1 386 (400-1)		1080-1 $\frac{1}{8}$ 386 (400-1 $\frac{1}{8}$)	NA

DURANT RGNL/EAKER FLD (DUA)
RNAV (GPS) RWY 35