

WAAS CH 69418 W25A	APP CRS 247°	Rwy Idg 3434 TDZE 8 Apt Elev 9
--	------------------------	---

RNAV (GPS) RWY 25

BEAUFORT EXEC (A.R.W.)



⚠

ASR

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Beaufort MCAS (Merritt Fld) altimeter setting and increase LPV DA to 226, LNAV/VNAV DA to 352, and all MDA 20 feet. VDP and Baro-VNAV NA when using Beaufort MCAS (Merritt Fld) altimeter setting.

MISSED APPROACH:
Climb to 2000 direct
EROMY and hold.

AWOS-3 119.675	BEAUFORT APP CON★ 125.125 292.125	UNICOM 122.7 (CTAF) 0
--------------------------	---	---------------------------------

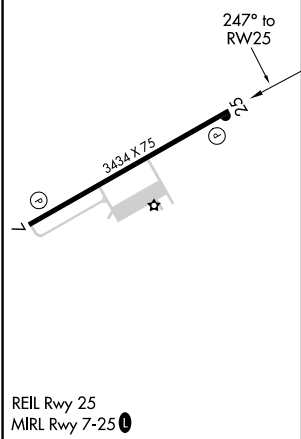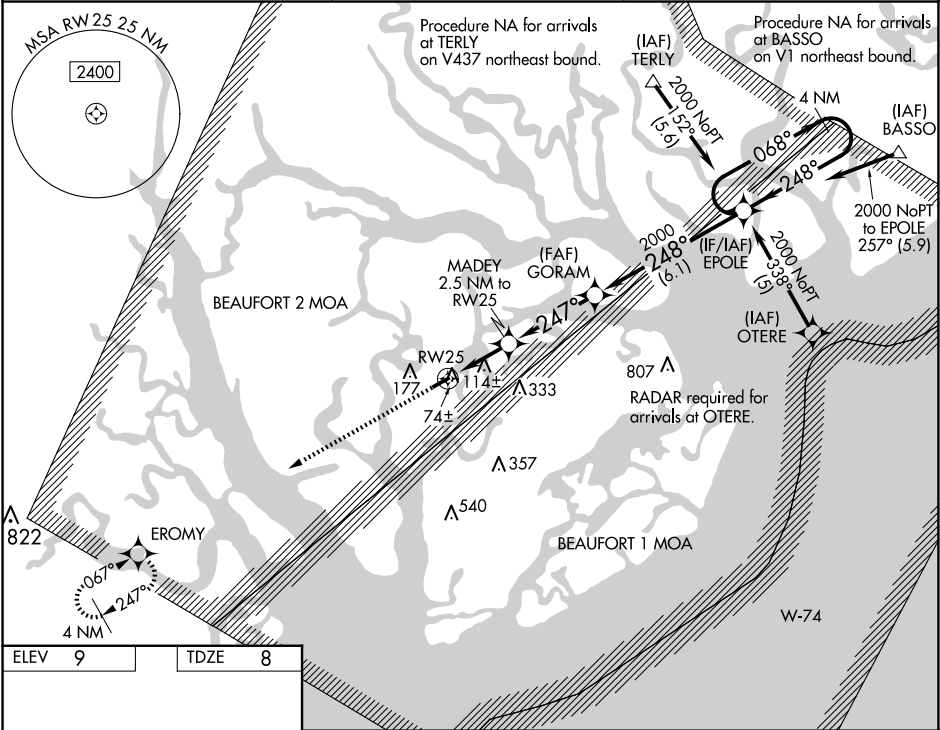

2000 EROMY VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 25).				
*LNAV only.				
MADEY 2.5 NM to RW25 GORAM 2000 EPOLE 4 NM Holding Pattern 247° 248° 068° 248° 2000 GP 3.00° TCH 40				
-1.1 -1.4 3.5 NM 6.1 NM				
CATEGORY	A		B	C
LPV DA	208-1		200 (200-1)	NA
LNAV/VNAV DA	334-1¼		326 (400-1¼)	NA
LNAV MDA	380-1		372 (400-1)	NA
CIRCLING	480-1		471 (500-1)	640-1¾ 631 (700-1¾)

SE-2, 04 SEP 2025 to 02 OCT 2025

SE-2, 04 SEP 2025 to 02 OCT 2025