


WAAS CH 78022 W05B	APP CRS 052°	Rwy Ldg 11004 TDZE 744 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5L

RICKENBACKER INTL (LCK)

RNP APCH - GPS.					MALSR	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
Circling NA northwest of Rwy 5L-23R. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 979 feet; increase LNAV/VNAV DA to 1042 feet; increase all MDAs 40 feet and Circling visibility Cat D ¼ SM.						
ATIS 132.75	COLUMBUS APP CON 134.0 279.6		RICK TOWER 120.05 348.4		GND CON 125.275 275.8	CLNC DEL 125.275 275.8

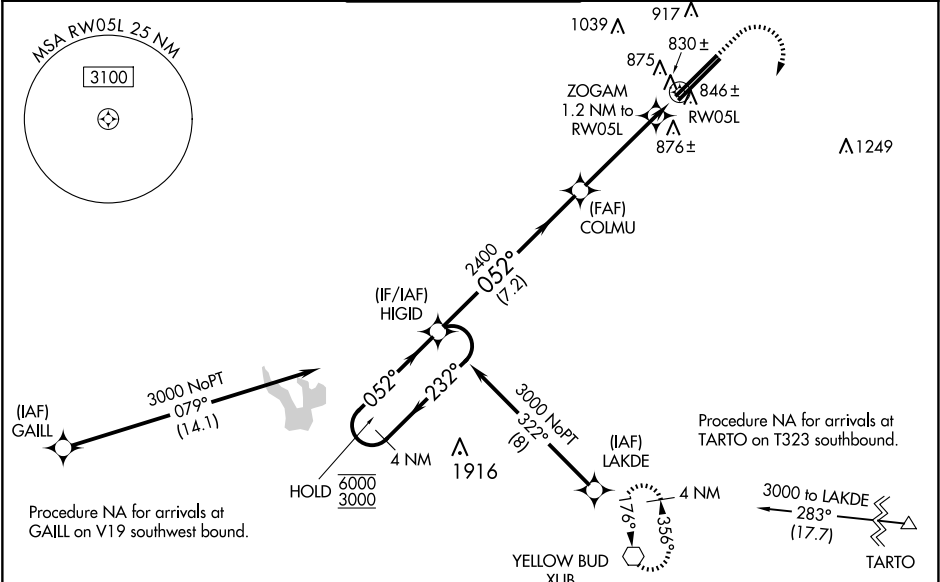

ELEV 744					D	TDZE 744	
VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).					1500	3000	XUB
4 NM Holding Pattern							
CATEGORY	A		B		C		D
LPV DA	944-1/2		200 (200-1/2)				
LNAV/VNAV DA	1007-1/2		263 (300-1/2)				
LNAV MDA	1100-1/2	356 (400-1/2)	1100-5/8		356 (400-5/8)		
CIRCLING	1240-1	496 (500-1)	1280-1 1/2 536 (600-1 1/2)		1400-2 656 (700-2)		

51.5R
052°
TWR 852
1992 X 50
12103 X 200
AS, A, S