

LOC/DME I-BXP 110.15 Chan 38 (Y)	APP CRS 173°	Rwy Ldg TDZE 5339 Apt Elev 5434
--	------------------------	---

ILS or LOC RWY 17L

DENVER INTL (DEN)


▼ For inoperative MALS/R, increase S-LOC Cats C/D visibility to RVR 4500.
S-LOC 17L DME or RADAR required. Simultaneous approaches
authorized with Rwy 17R and 16L/16R.
RVR 1800 authorized with the use of FD or AP or HUD to DA.

MALS/R



MISSED APPROACH: Climb to 5900
then climbing left turn to 10000 on
heading 120° and FQF VORTAC R-078
to LIMEX INT/FQF 31.9 DME and hold.


D-ATIS 125.6 379.9 (ARR) 134.025 (DEP)	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 132.35 239.275	GND CON 121.35 379.175 (W) 121.85 377.1 (E)	CLNC DEL 118.75	CPDLC
--	---	---------------------------------------	---	---------------------------	-------

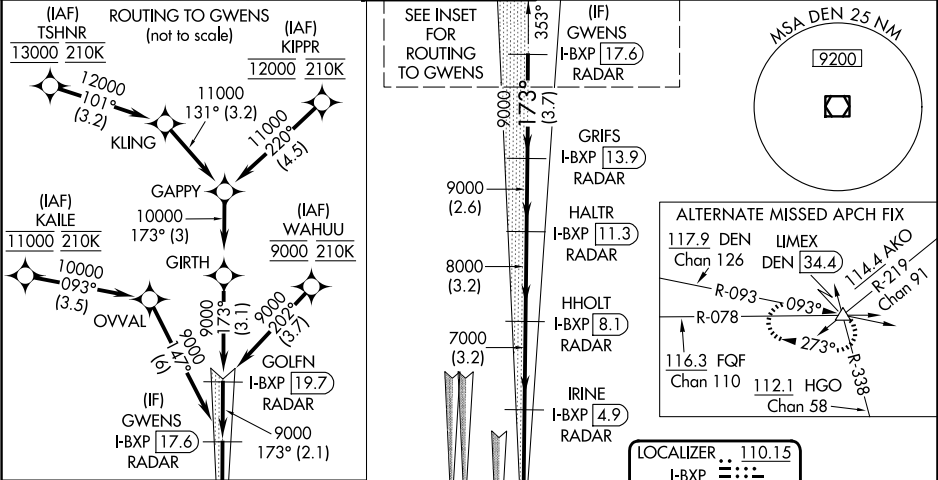

ELEV 5434

TDZE 5339

DENVER
117.9 DEN
Chan 126

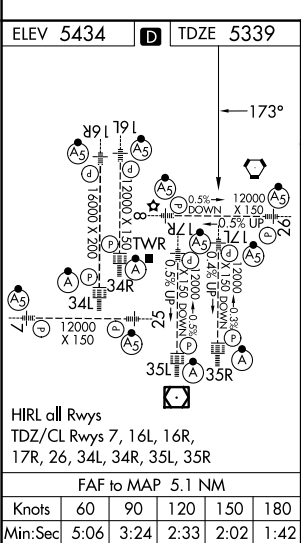

RADAR or GPS
REQUIRED

