

ILS or LOC RWY 25
DENVER INTL (DEN)

MALSR

MISSED APPROACH: Climb to 10000 on heading 263° and on FQF VORTAC R-306 to HYGEM INT/FQF 37.9 DME and hold.

MISSED APCH FIX

HYGEN FQF [37.9]

114.2 GL R-221 Chan 89

126°

306° R-306

116.3 FQF Chan 110

LOCALIZER .. 111.55

I-ERP [111.55]

Chan 52(Y)

DENVER

117.9 DEN [117.9]

Chan 126

FALCON

116.3 FQF [116.3]

Chan 110

ALTERNATE MISSED APCH FIX

HYGEN DEN [31.5]

114.2 GL R-221 Chan 89

122°

302° R-302

117.9 DEN Chan 126

MSA DEN 25 NM

9200

ELEV 5434

D

TDZE 5355

7000

263°

(10)

083°

GASTI INT

I-ERP [4.8]

RADAR

ETHAL INT

I-ERP [14.8]

RADAR

R-306

R-002


R-043

5468

HIRL all Rwy 7
TDZ/CL Rwy 7, 16L, 16R, 17R,
26, 34L, 34R, 35L, 35R

FAF to MAP 5 NM					
Knots	60	90	120	150	180
Min:Sec	5:00	3:20	2:30	2:00	1:40

RADAR REQUIRED

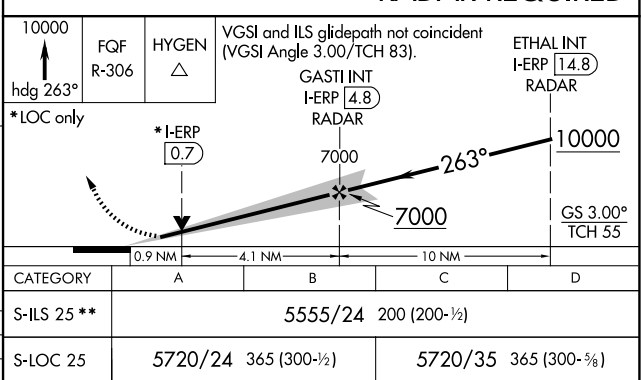

SW-1, 04 SEP 2025 to 02 OCT 2025