


WAAS CH 99603 W10A	APP CRS 101°	Rwy Ldg 10114 TDZE 809 Apt Elev 815
--	------------------------	--

RNAV (GPS) Y RWY 10R
JOHN GLENN COLUMBUS INTL (CMH)

RNP APCH.						MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.	
 For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inop ALS, increase LNAV Cat C/D visibility to 1½ SM. Simultaneous approach authorized.							
D-ATIS 124.6		COLUMBUS APP CON 125.95 371.975		COLUMBUS TOWER 132.7 257.8		GND CON 121.9 348.6	
						CLNC DEL 126.3	
						CPDLC	

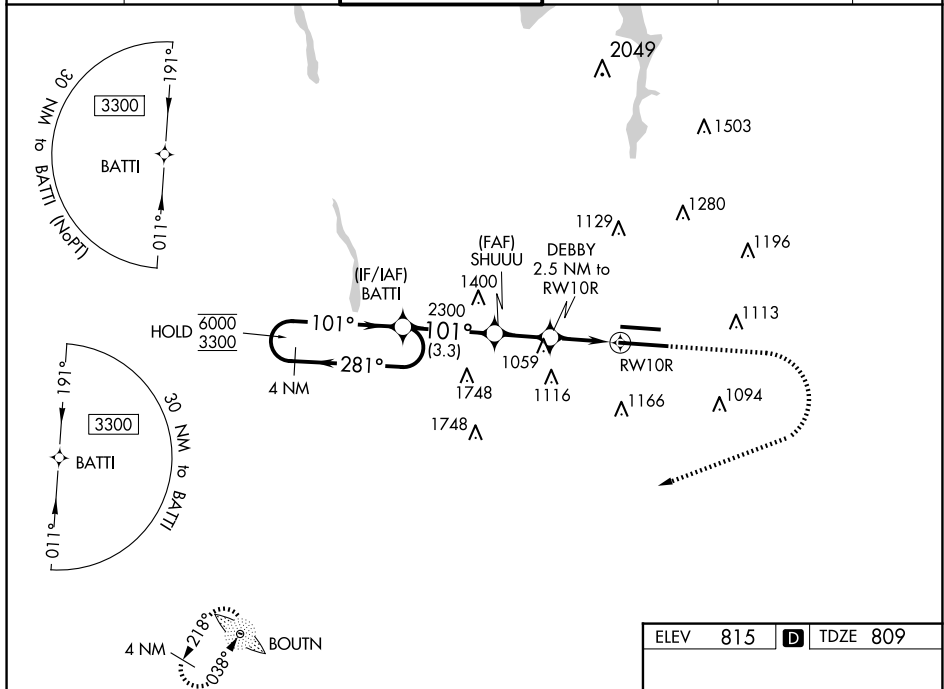

4 NM Holding Pattern

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00°/TCH 70°).

BATTI SHUUU DEBBY
2.5 NM to RW10R

6000 ← 281°
3300 → 101°

GP 3.00°
TCH 54

*LNNAV only.

3.3 NM 2 NM 1.1 NM 1.4 NM

RW10R

