
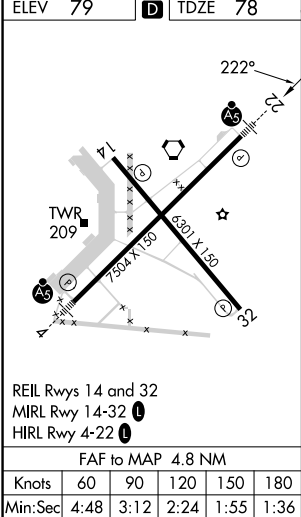



LOC I-MZR 109.5	APP CRS 222°	Rwy Idg TDZE Apt Elev 7504 78 79
---------------------------	------------------------	--

ILS or LOC RWY 22
MONROE RGNL (MLU)

DME or RADAR required for procedure entry.	MALSR 	MISSED APPROACH: Climb to 1800 then climbing right turn to 3000 direct MLU VORTAC and hold, continue climb-in-hold to 3000.
Circling Rwy 14 NA at night. For inop ALS, increase S-LOC 22 Cat C/D visibility to 1½ SM. # DME from MLU VORTAC.		

ATIS 125.05	MONROE APP CON ★ 118.15 290.475	MONROE TOWER ★ 118.9 (CTAF) 257.8	GND CON 121.9	CLNC DEL 121.65	UNICOM 122.95
-----------------------	---	---	-------------------------	---------------------------	-------------------------

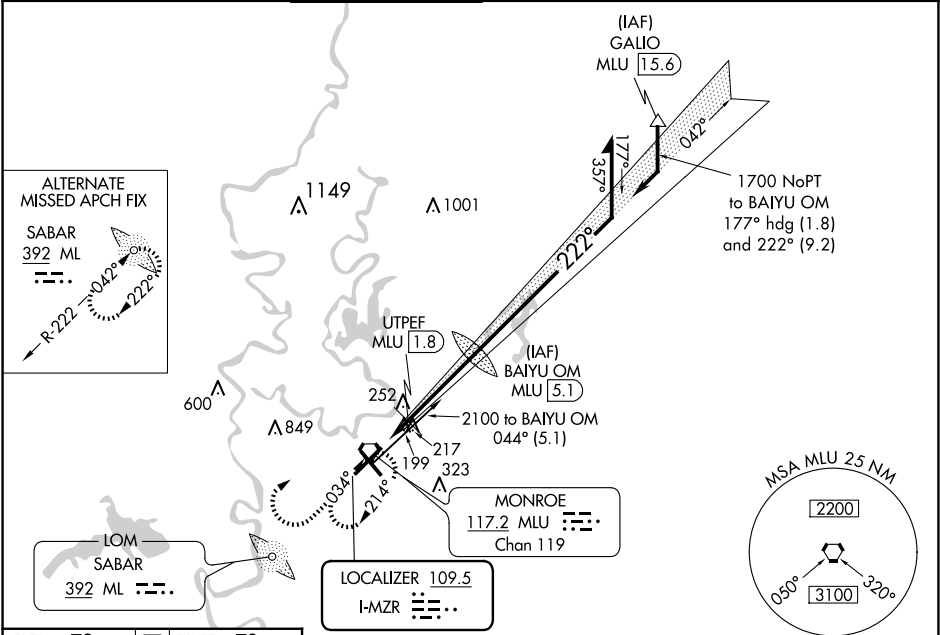

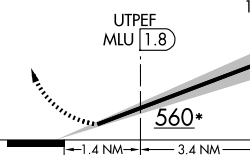1800	3000	MLU	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 50).			
						
*LOC only.						
			BAIYU OM MLU <u>5.1</u>			Remain within 10 NM
UTPEF MLU <u>1.8</u>			1675	042°	2100	
560*			1700	222°	GS 3.00° TCH 54	
—1.4 NM—			—3.4 NM—			
CATEGORY	A	B	C	D		
S-ILS 22	278-½ 200 (200-½)					
S-LOC 22	560-½	482 (500-½)	560-1	482 (500-1)		
 CIRCLING	580-1	501 (600-1)	740-¾ 661 (700-¾)	1160-3 1081 (1100-3)		
# UTPEF FIX MINIMUMS						
S-LOC 22	500-½	422 (500-½)	500-¾	422 (500-¾)		
 CIRCLING	580-1	501 (600-1)	740-¾ 661 (700-¾)	1160-3 1081 (1100-3)		

SC-4, 02 OCT 2025 to 30 OCT 2025

SC-4, 02 OCT 2025 to 30 OCT 2025