
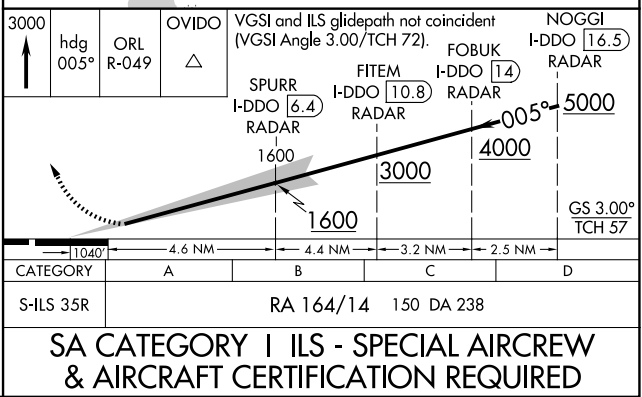
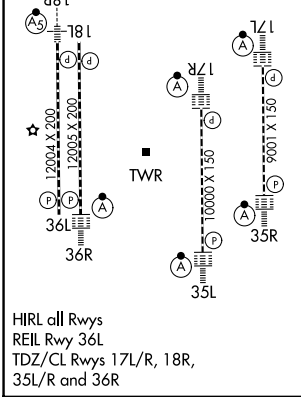


LOC/DME I-DDO 110.5 Chan 42	APP CRS 005°	Rwy Ldg TDZE 88 Apt Elev 96
---	------------------------	---

ILS RWY 35L (SA CAT I)
ORLANDO INTL (MCO)

RADAR required for procedure entry. DME or RADAR required.			ALSIF-2 	MISSED APPROACH: Climb to 3000 on heading 005° and ORL VORTAC R-049 to OVIDO INT/ ORL 13 DME and hold.
Requires specific OPSPEC, MSPEC or LOA approval. Simultaneous approach authorized. Bright lights on highway midway between Rwy 35L and Rwy 35R may be mistaken for runway lights. When using alternate missed approach, simultaneous approach NA.				
D-ATIS ARR 121.25 DEP 120.525	ORLANDO APP CON 124.8 307.0	ORLANDO TOWER 118.45 253.5 124.3 253.5 (17L-35R, 17R-35L) (18L-36R, 18R-36L)	GND CON 126.4 (E) 121.8 (W)	CLNC DEL 134.7 341.7
			CPDLC	

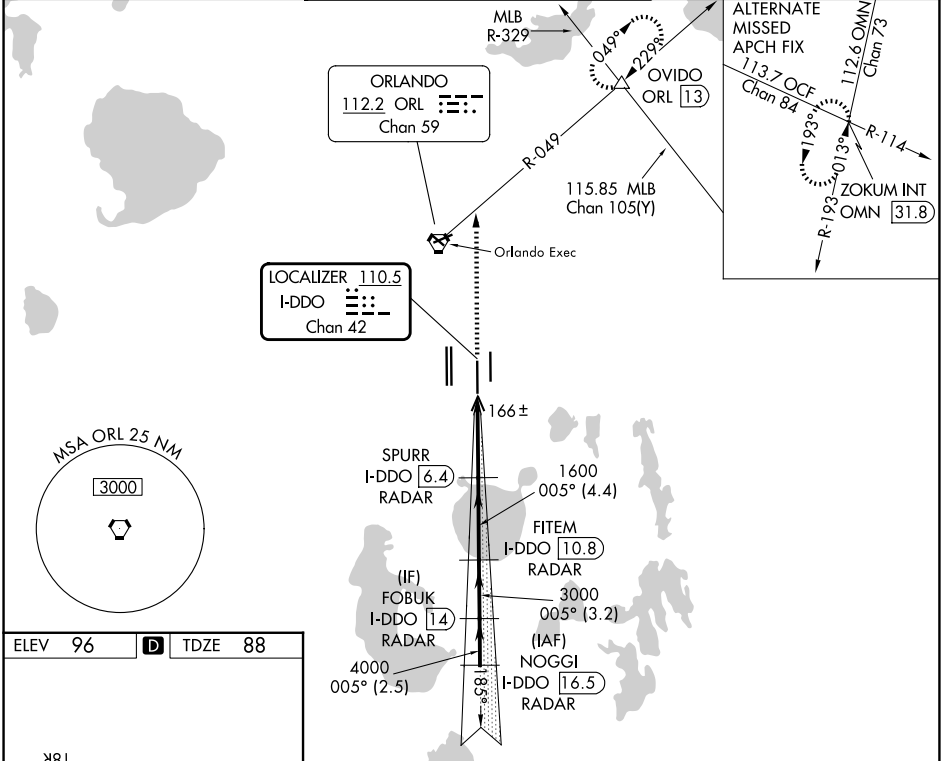

SE-3, 02 OCT 2025 to 30 OCT 2025

SE-3, 02 OCT 2025 to 30 OCT 2025