

WAAS CH 45810 W34A	APP CRS 344°	Rwy Idg 8500 TDZE 379 Apt Elev 433
--	------------------------	---

RNAV (GPS) Y RWY 34L

SEATTLE-TACOMA INTL (SEA)


⚠ DME/DME RNP -0.3 NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -6°C (22°F) or above 54°C (130°F). Use of FD or AP providing RNAV track guidance required during simultaneous operations. LNAV procedure NA during simultaneous operations. Simultaneous approach authorized with Rwy 34R/C. For inoperative ALS, increase LNAV/VNAV all Cats visibility to 1 3⁄8 SM, increase LNAV Cat A and B visibility to RVR 5500 and Cat C and D visibility to 1 3⁄8 SM. # RVR 1800 authorized with use of FD or AP or HUD to DA.

MALS R



MISSED APPROACH: Climb to 900 then climbing left turn to 5000 direct LOFAL and hold.

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (Rwys 16L, 16C, 34C, 34R) 120.95 239.3 (Rwys 16R, 34L)	GND CON 121.7	CLNC DEL 128.0	CPDLC
------------------------	---	--	-------------------------	--------------------------	-------

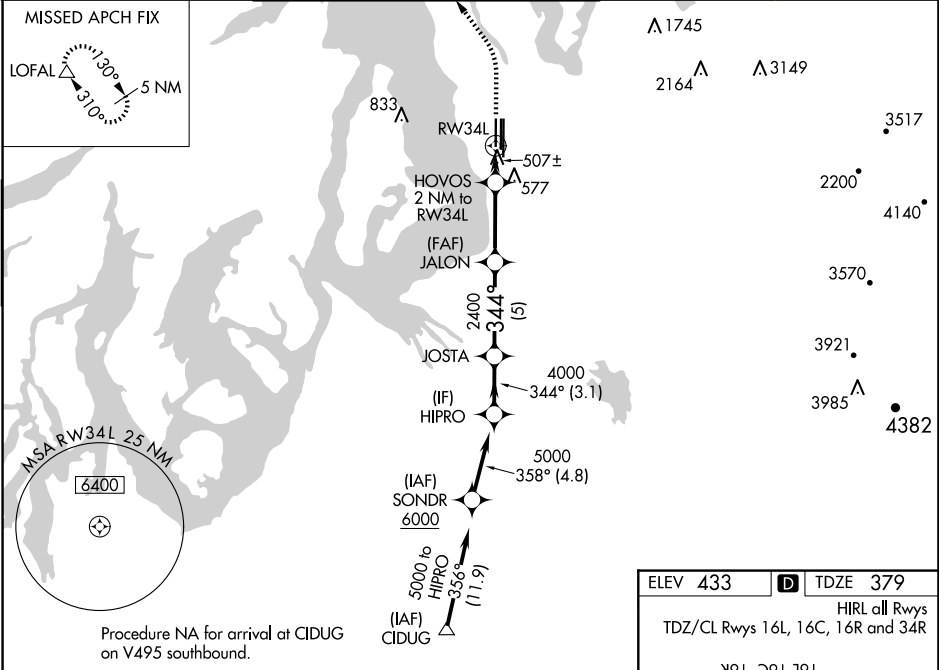

HIPRO		VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 75).		900	5000	LOFAL
JOSTA		JALON		*LNAV only		
5000		2400		*1040		
GP 3.00°		TCH 55		*1.4 NM to RWY34L		
3.1 NM		5 NM		0.6		
CATEGORY		A		B		
LPV DA#		579/24		200 (200-1⁄2)		
LNAV/VNAV DA		808/40		429 (400-3⁄4)		
LNAV MDA		860/24		481 (500-1⁄2)		
CIRCLING		1000-1		567 (600-1)		
		1000-1 1⁄2		567 (600-1 1⁄2)		
		1000-2		567 (600-2)		

