

KING SALMON, ALASKA

HI-VOR Z or TACAN Z RWY 12


VORTAC AKN 112.8 Chan 75	APCH CRS 116°	Rwy Idg 8501 TDZE 62 Arpt Elev 73	[USAF]	KING SALMON (AKN) (PAKN)
--	-------------------------	--	--------	--------------------------

DME required. RADAR required for procedure entry.



MALSR

MISSED APPROACH: Climbing right turn to 3000 on heading 238° and AKN VORTAC R-210 to OLLER/15 DME and hold.

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	TOWER ★ 118.3 279.5	GND CON 121.9	CTAF 121.9 352.05	UNICOM 122.95
---------------	---------------------------------	------------------------	------------------	----------------------	------------------

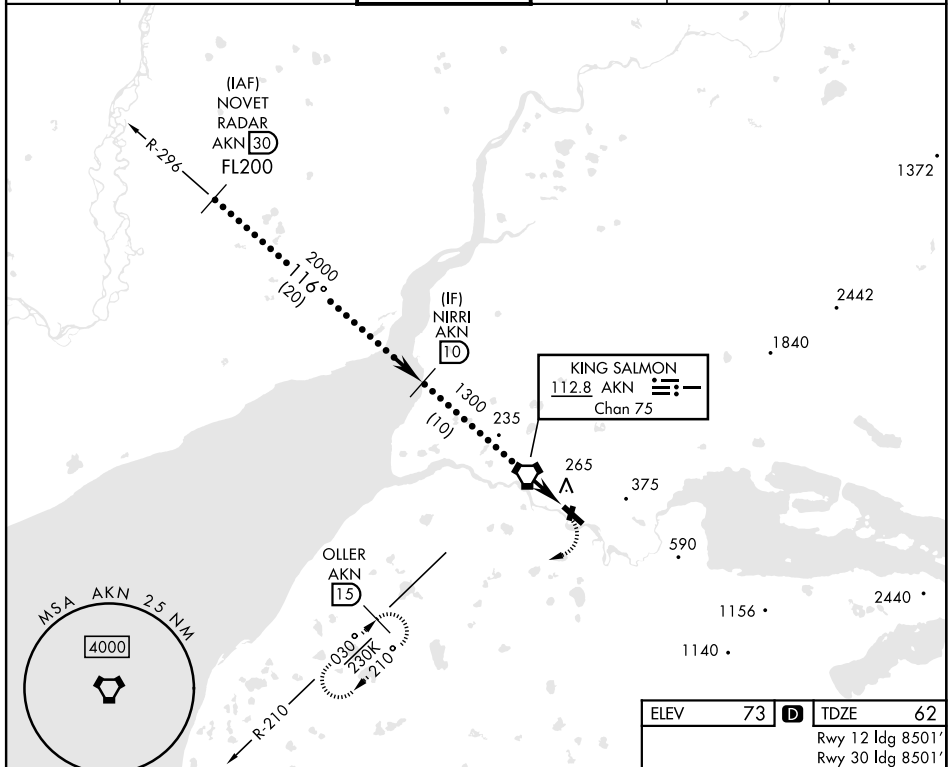

EMERG SAFE ALT 100 NM 9900

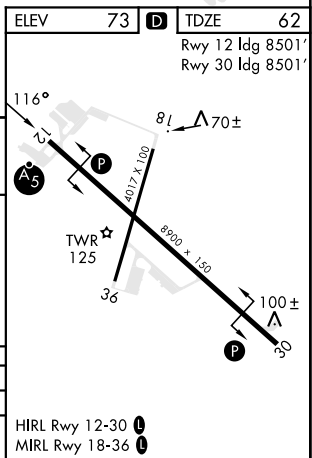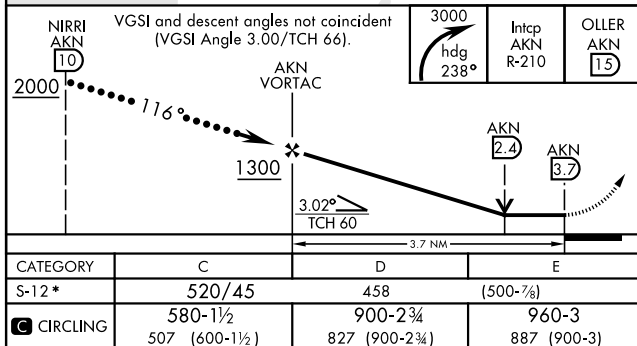

KING SALMON, ALASKA

58°41'N-156°39'W

KING SALMON (AKN) (PAKN)

Amdt 5 26DEC24

HI-VOR Z or TACAN Z RWY 12

AK, 02 OCT 2025 to 27 NOV 2025

AK, 02 OCT 2025 to 27 NOV 2025