

LAKEVIEW, OREGON

AL-5552 (FAA)

25163

WAAS CH 93532 W17A	APP CRS 166°	Rwy Ldg 5318 TDZE 4734 Apt Elev 4734
--	------------------------	---

RNAV (GPS) RWY 17
LAKE COUNTY (LKV)


RNP APCH.



Circling NA east of Rwy 17-35. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -24°C or above 50°C.

MISSED APPROACH: Climb to 11000
direct EYIGO and on track 152° to
CHOIR and hold.

AWOS-3PT 135.525	SEATTLE CENTER 127.6 346.35	UNICOM 122.8 (CTAF) 0
----------------------------	---------------------------------------	--

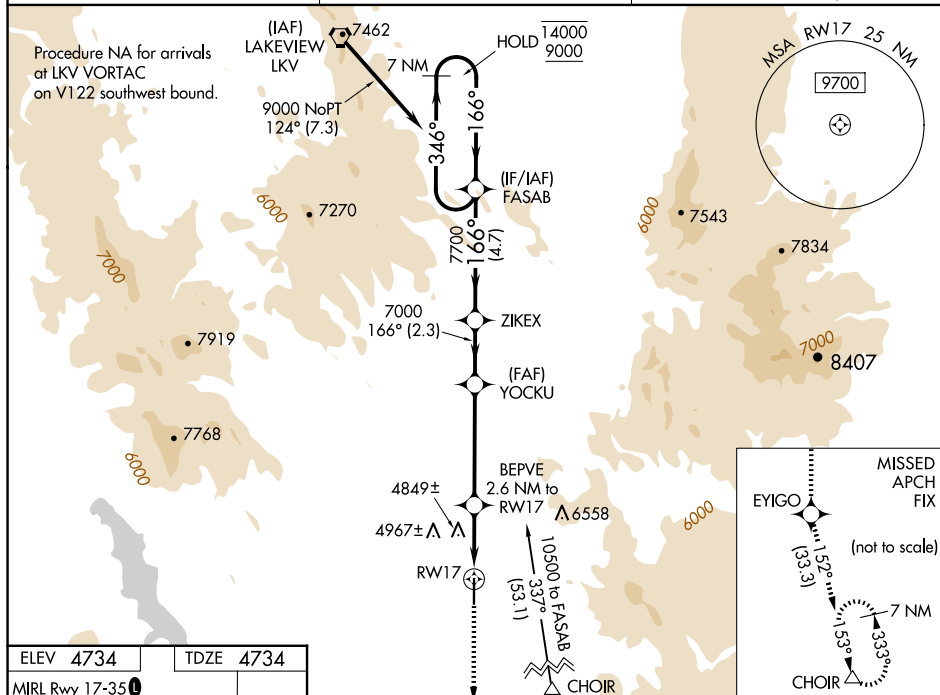

ELEV	4734
------	------

TDZE	4734
------	------

MIRA Rwy 17-35

REIL Rws 17 and 35

166°

5318 X 100

4772

35

11000 ↑	EYGO ✦	fr 152° △	CHOIR				FASAB	7 NM Holding Pattern
*LNAV only.			BEPVE 2.6 NM to RW17	YOCKU 7000	ZIKEX 7700	166°	346° → ← 166°	14000 9000
RW17 *1 NM to RW17			5620*	7000				GP 3.00° TCH 45
1 NM			1.6 NM	4.3 NM	2.3 NM	4.7 NM		
CATEGORY	A		B		C		D	
LPV DA			4984-1		250 (300-1)			
LNAV/ VNAV DA			5139-1½		405 (500-1½)			
LNAV MDA			5100-1		366 (400-1)			
C CIRCLING	5160-1 426 (500-1)		5220-1 486 (500-1)		5460-2 726 (800-2)		5500-2½ 766 (800-2½)	

LAKEVIEW, OREGON

Amdt 1 28FEB19

42°10'N-120°24'W

LAKE COUNTY (LKV)

RNAV (GPS) RWY 17

NW-1, 02 OCT 2025 to 30 OCT 2025