
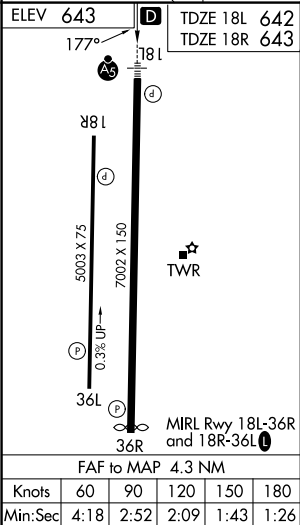


LOC I-DTO 109.1	APP CRS 177°	Rwy Ldg	18L	18R
		TDZE	6502 642	5003 643
		Apt Elev	643 643	643 643

ILS or LOC RWY 18L

DENTON ENTERPRISE (D'TO)

ADF required. RADAR required for procedure entry.			MALSR 	MISSED APPROACH: Climb to 2500 then right turn direct PINCK LOM and hold.
NA	For inop ALS, increase S-ILS 18L all Cats visibility to ¾ SM. For inop ALS, increase S-LOC 18L Cat C/D to 1¾ SM.			
ATIS 119.325	LONE STAR APP CON 118.1 306.95	DENTON TOWER ★ 119.95 (CTAF) 0	GND CON 123.95	

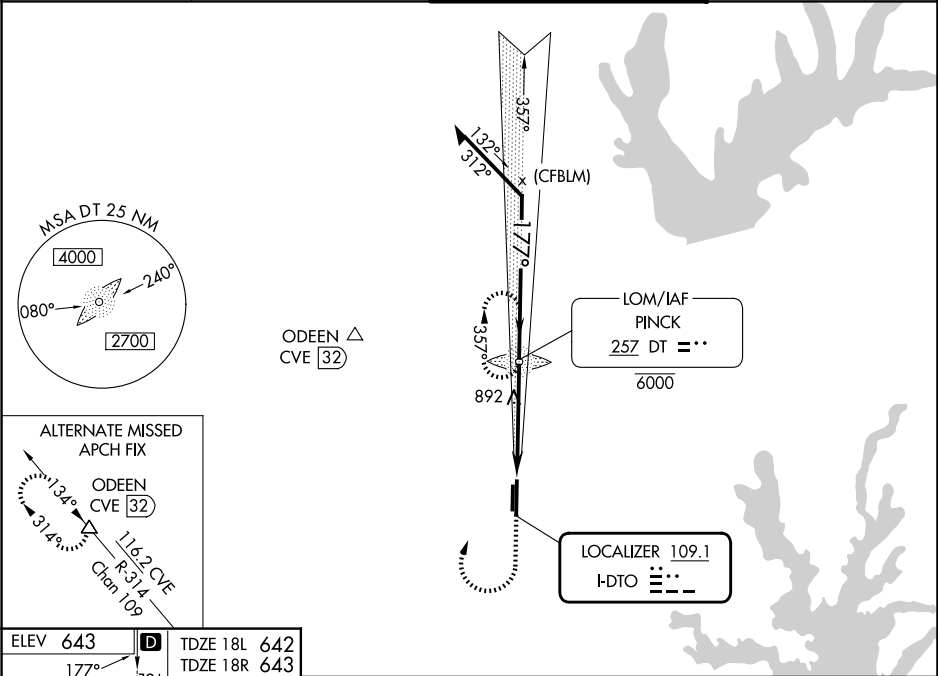

2500

↑

DT

6000

DT LOM PINCK

Remain within 10 NM

357°

2070

2500

177°

2200

GS 3.00°

TCH 53

4.3 NM

YGSJ and ILS glidepath not coincident (YGSJ Angle 3.00/TCH 54).

CATEGORY	A	B	C	D
S-ILS 18L	842-½		200 (200-½)	
S-LOC 18L	1160-½	518 (600-½)	1160-1	518 (600-1)
SIDESTEP 18R	1260-1	617 (700-1)	1260-1¾ 617 (700-1¾)	1260-2 617 (700-2)
CIRCLING	1260-1	617 (700-1)	1380-2 737 (800-2)	1380-2¼ 737 (800-2¼)

SC-2, 02 OCT 2025 to 30 OCT 2025

SC-2, 02 OCT 2025 to 30 OCT 2025