

COLUMBUS, MISSISSIPPI

TACAN RWY 31R

VORTAC CBM	APCH CRS	Rwy Idg
115.2	302°	8016
Chan 99		TDZE 218
		Arprt Elev 218

[USAF]


COLUMBUS AFB (KCBM)

Missed approach requires use of RNAV or ATC RADAR monitoring.	MISSED APPROACH: Climbing right turn to WOLOV and hold as published. Maintain 3000.
---	---


ATIS ★ 115.2 273.5	APP CON ★ N 126.075 239.25 SE 134.55 350.3 SW 135.6 323.275	TOWER ★ 126.65 379.925	GND CON ★ 121.9 275.8
-----------------------	--	---------------------------	--------------------------

Straight-in Rwy 31R at Night, operational VGSI required, remain on or above VGSI glidepath until threshold.


USAF Only: When VGSI inop, Straight-in Rwy 31R authorized at night with aircrew command approval. Visibility reduction by helicopters NA.

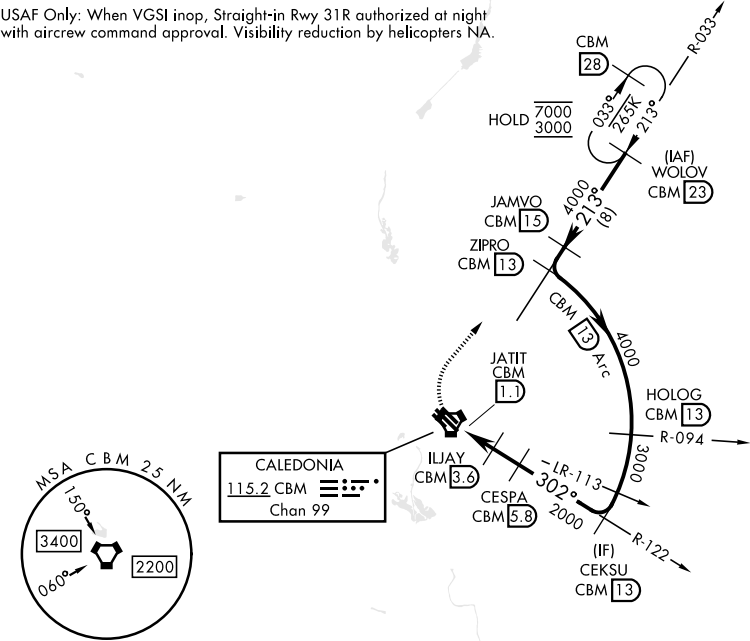

EMERG SAFE ALT 100 NM 3700

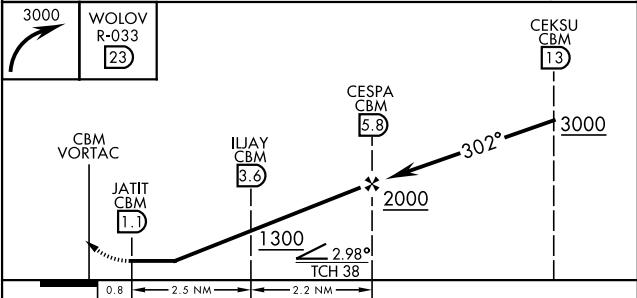

ELEV	218	TDZE	218
------	-----	------	-----

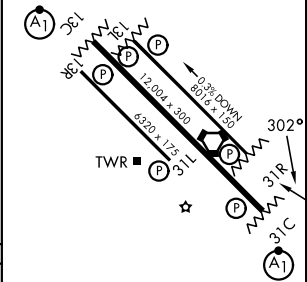

CATEGORY	A	B	C	D	E
S-31R	680/55 462 (500-1)	680-1 3/8 462 (500-1 3/8)			
CIRCLING	700-1 482 (500-1)	720-1 502 (600-1)	740-1 1/2 522 (600-1 1/2)	880-2 662 (700-2)	1240-3 1022 (1100-3)

MIRL Rwy 13R-31L
HIRL Rwy 13C-31C, 13L-31R

COLUMBUS, MISSISSIPPI

33° 39' N-88° 27' W

COLUMBUS AFB (KCBM)

Amtd 1 21APR22

TACAN RWY 31R

SC-4, 30 OCT 2025 to 27 NOV 2025

SC-4, 30 OCT 2025 to 27 NOV 2025