

NOTE: RADAR required.

NOTE: RNAV 1.

NOTE: DME/DME/IRU or GPS required.

NOTE: Expect Rwy 21L.


NOTE: Jet aircraft descend via Mach number until intercepting 280K. Maintain 280K until slowed by the STAR.

280K. Maintain 280K until slowed by the STAR.

NOTE: For use when DTW landing south or west. When DTW landing north, file and expect the WNGNT RNAV STAR.



D-ATIS
133.675
DETROIT APP CON
126.225 284.0

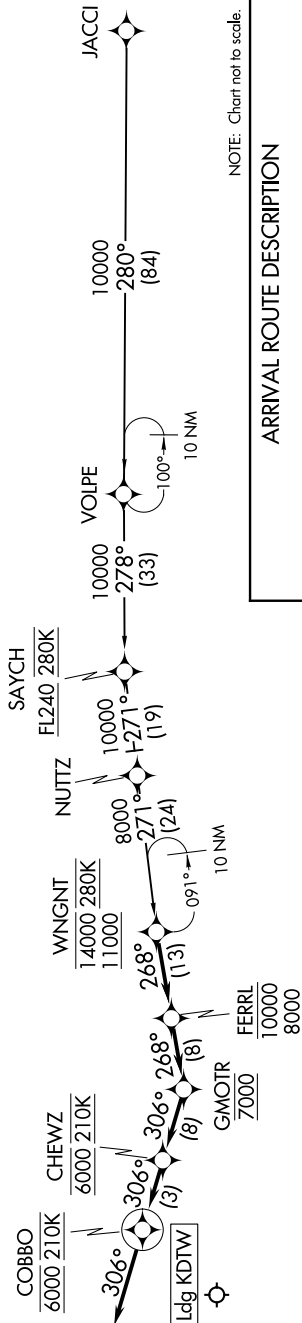

NOTE: Chart not to scale.

ARRIVAL ROUTE DESCRIPTION

JACCI TRANSITION (JACCI.FERRL2)

From WNGNT on track 268° to cross FERRI between 8000 and 10000, then on track 248° to cross GMOTR at 7000, then on track 306° to cross CHEWZ at 6000 and at 210K, then on track 306° to cross COBBO at 6000 and at 210K, then on track 306°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS:

From COBBO, execute ILS Rwy 21L approach.

FERRL TWO ARRIVAL (RNAV)

(WNGNT.FERRL2) 10OCT19

DETROIT, MICHIGAN

DETROIT METRO WAYNE COUNTY (DTW)