

LOC I-EFD <u>111.1</u>	APP CRS 354°	Rwy Ldg TDZE Apt Elev	9001 28 33
----------------------------------	------------------------	-----------------------------	---------------------------------------

ILS Z or LOC Z RWY 35L
ELLINGTON (EFD)

RADAR required for procedure entry.


- T** Circling NA west of Rwy 17R-35L. DME from EFD TACAN.
A Simultaneous reception of I-EFD and EFD DME required.
 Inop table does not apply to S-ILS 35L. For inop ALS, increase S-LOC 35L Cat C/D/E visibility to 1 3/4 SM. For inop ALS when using JUVUM fix minimums, increase S-LOC 35L Cat C/D/E visibility to RVR 6000.

MALSF



MISSED APPROACH: Climb to 700 then climbing right turn to 3100 on VUH VOR/DME R-320 to WATFO INT/VUH 9.3 DME and hold. (TACAN aircraft climb to 700 then climbing right turn to 3100 on EFD TACAN R-136 to WATFO/EFD 16 DME and hold southeast, left turn, 316° inbound).

ATIS 135.575 269.9	HOUSTON APP CON 134.45 284.0	ELLINGTON TOWER 126.05 253.5	GND CON 121.6 275.8
---	---	---	--

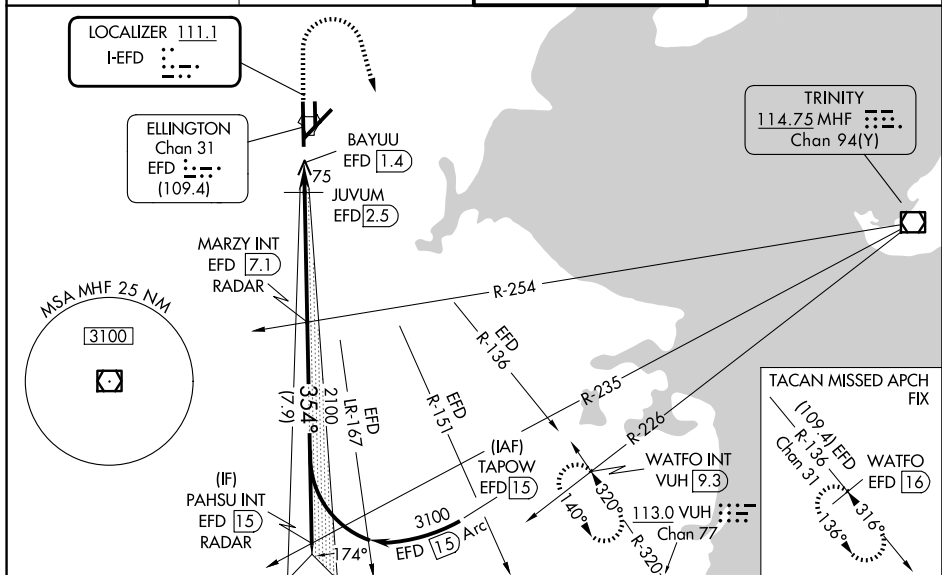

ELEV 33 **D** TDZE 28

HIRL Rwy 4-22 and 17R-35L
TDZ/CL Rwy 17R, 22 and 35L

TWR

FAF to MAP 5.7 NM

Knots	60	90	120	150	180
Min:Sec	5:42	3:48	2:51	2:17	1:54

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 32).

PAHSU INT EFD 15 RADAR

MARZY INT EFD 7.1 RADAR

JUVUM EFD 2.5

BAYUU EFD 1.4

3100

2100

620*

354°

GS 3.00° TCH 54

0.6 NM 1.1 NM 4.6 NM 7.9 NM

CATEGORY	A	B	C	D	E
S-ILS 35L	228/40 200 (200-3/4)				
S-LOC 35L	620/40	592 (600-3/4)	620-1 3/8		592 (600-1 3/8)
CIRCLING	620-1	587 (600-1)	620-1 3/4 587 (600-1 3/4)	640-2 607 (700-2)	700-2 1/4 667 (700-2 1/4)
JUVUM FIX MINIMUMS (DME REQUIRED)					
S-LOC 35L	440/40	412 (500-3/4)	440/50		412 (500-1)
CIRCLING	500-1	467 (500-1)	580-1 1/2 547 (600-1 1/2)	640-2 607 (700-2)	700-2 1/4 667 (700-2 1/4)