

WAAS CH 56416 W34A	APP CRS 339°	Rwy Ldg 5387 TDZE 322 Apt Elev 341
--	------------------------	---

RNAV (GPS) RWY 34
HAWKINS FLD (HKS)


HAWKINS FLD (HKS)

T For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -6°C (22°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. Baro-VNAV and VDP NA when using Jackson-Medgar Wiley Evers Intl altimeter setting. When local altimeter setting not received, use Jackson-Medgar Wiley Evers Intl altimeter setting and increase all DA 19 feet and all MDA 20 feet. Increase LPV and LNAV/VNAV all Cats visibility $\frac{1}{8}$ mile and Circling Cat C visibility $\frac{1}{4}$ mile. Rwy 34 helicopter visibility reduction below $\frac{3}{4}$ SM NA.

MISSED APPROACH.
Climb to 2000 direct
OCARO and hold.


ASOS 120.625	JACKSON APP CON ★ 123.9 319.2	HAWKINS TOWER ★ 119.65 (CTAF) 0 257.8	GND CON 121.9 239.0	CLNC DEL 121.9 (When twr closed)	UNICOM 122.95
------------------------	---	---	-------------------------------	---	-------------------------

MISSED APCH FIX

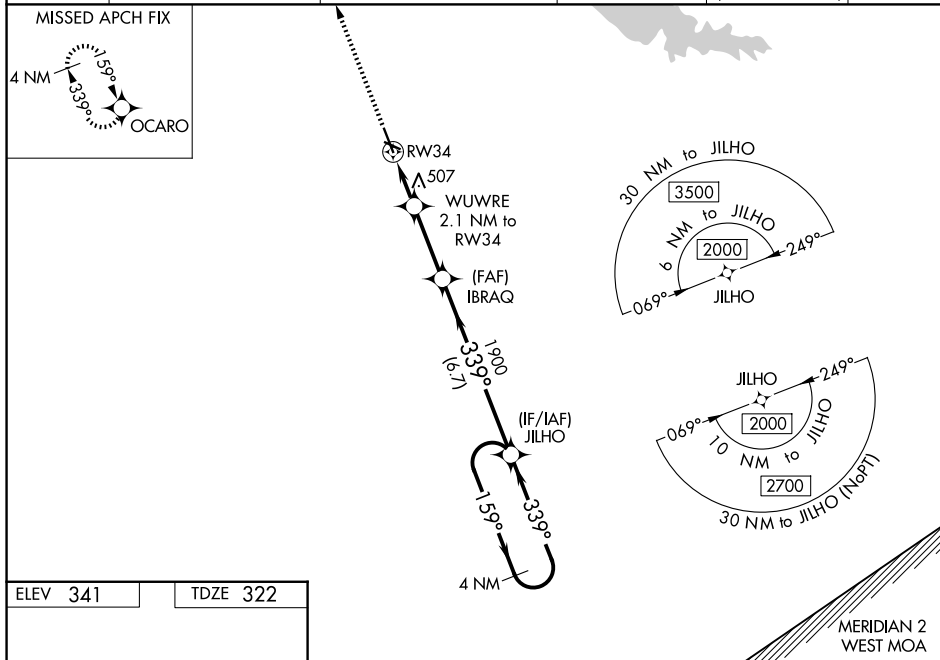

SC-4, 30 OCT 2025 to 27 NOV 2025

ELEV 341		TDZE 322
----------	--	----------

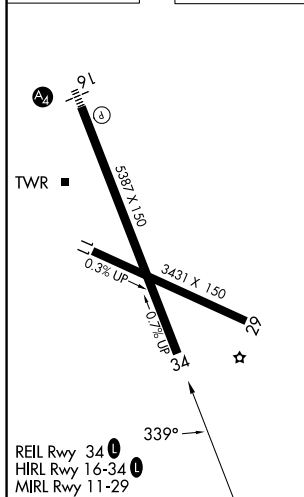[illegible]