

TACAN NYL
Chan 84

HI-TACAN Z RWY 3L

[USN]

YUMA MCAS/YUMA INTL (KNYL)



MISSED APPROACH: Climbing left turn to 4000, intercept
NYL TACAN R-022 to JIBUN, cross JIBUN at or above 4000.

ATIS
118.8 2

APP CON
124.7 371.975

TOWER
119.3 (CTAF) 377.075

GND CON
121.9 314.0

CLNC DEL
118.0 336.4

ASR/
PAR


Knots	60	120	180	240	300	360
V/V(fpm)	325	650	975	1300	1625	1950
ATC climb of 325 ft/NM to 4000						

Request holding from
Los Angeles ARTCC prior
to frequency change to
MCAS Yuma Approach Control.


CAUTION:
R-2507 and R-2512 located
approximately 33 NM/28 NM
NW respectively of NYL TACAN.

CAUTION:
Short intmed, recommended
early configuration.

BLYTHE
117.4 BLH 
Chan 121

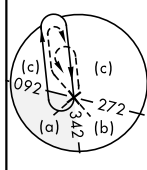

3701


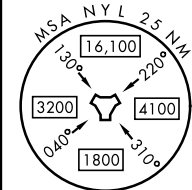


UNITED STATES
MEXICO

EMERG SAFE ALT 100 NM 17,100

ELEV	213	TDZE	195
------	-----	------	-----

3L-21R	13,300 x 200
3R-21L	9239 x 150
8-26	6146 x 150
17-35	5710 x 150

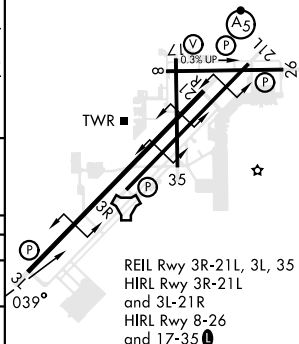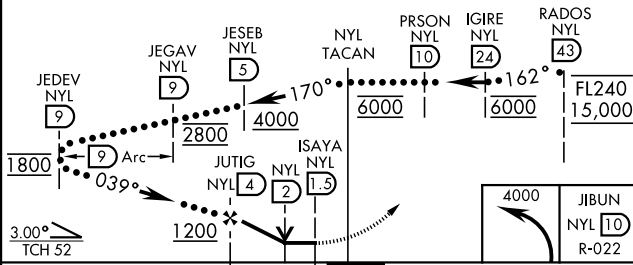

YUMA, ARIZONA

32°39'N-114°36'W

YUMA MCAS/YUMA INTL (KNYL)

Amdt 5 22APR21

HI-TACAN Z RWY 3L