

YIGO, GUAM I, GUAM

TACAN Y RWY 06R

VORTAC UNZ 115.8 Chan 105	APCH CRS 054°	Rwy Idg 11,200 TDZE 557 Arpt Elev 617
---	-------------------------	--

- (USAF)

ANDERSEN AFB (PGUA)

T * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles.
** Circling not authorized NW of Rwy 6L-24R.



ALSF-1

MISSED APPROACH: Climb to 3000, intercept UNZ R-053 to HAAMR and hold.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8	CLNC DEL 126.725 256.7
-------------------------	-------------------------------------	----------------------	------------------------	---------------------------

CAUTION: Environmentally Sensitive Area Flights along Anderson cliff line restricted to 1000' AGL or above.


All touchdown zones have a 1.0% down slope.

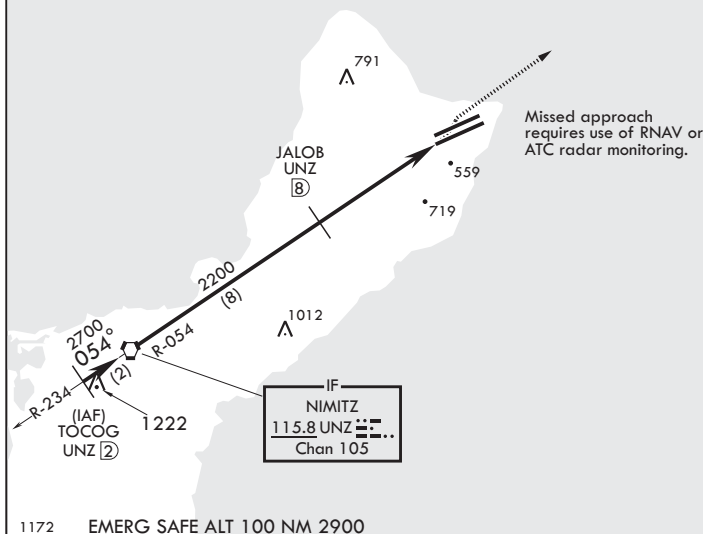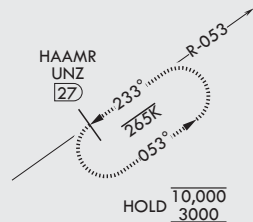

Missed approach requires use of RNAV or ATC radar monitoring.

MSA UNZ 25 NM

1172 EMERG SAFE ALT 100 NM 2900

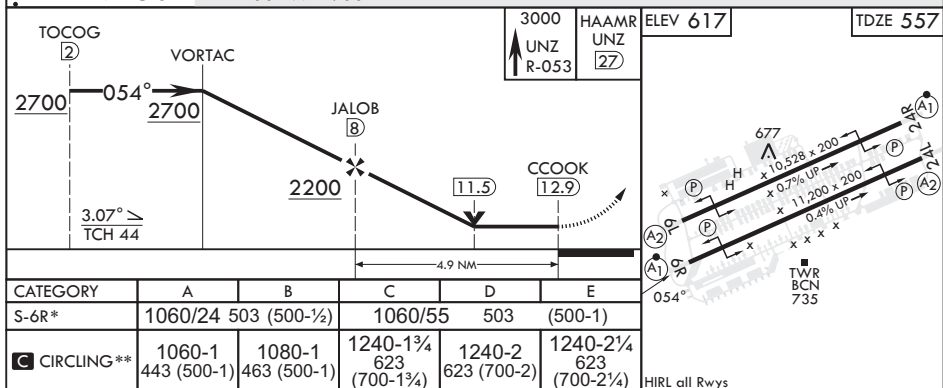

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Y RWY 06R