
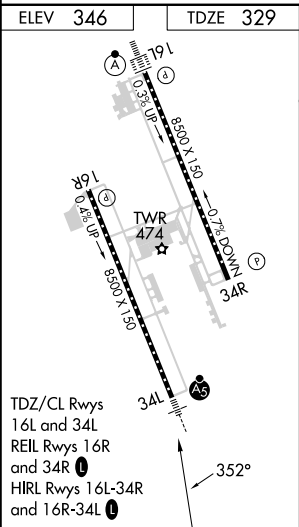


VORTAC MHZ	APP CRS	Rwy Idg	8500
113.2	352°	TDZE	329
Chan 79		Apt Elev	346

When local altimeter setting not received, use Hawkins Fld altimeter setting and increase all MDA 20 feet; increase S-34L Cats C/D/E visibility 1/8 mile.
Circling NA for Cat E southwest of Rwy 16R-34L. Helicopter visibility reduction below 3/4 SM NA.

MALSRR
MISSED APPROACH: Climbing right turn to 3000 on heading 120° and MHZ VORTAC R-134 to RAKIN INT/ MHZ 16.5 DME and hold.

ATIS 121.05	JACKSON APP CON★ 123.9 317.7	JACKSON TOWER★ 120.9 (CTAF) 352.0	GND CON 121.7 348.6	UNICOM 122.95
----------------	---------------------------------	--------------------------------------	------------------------	------------------

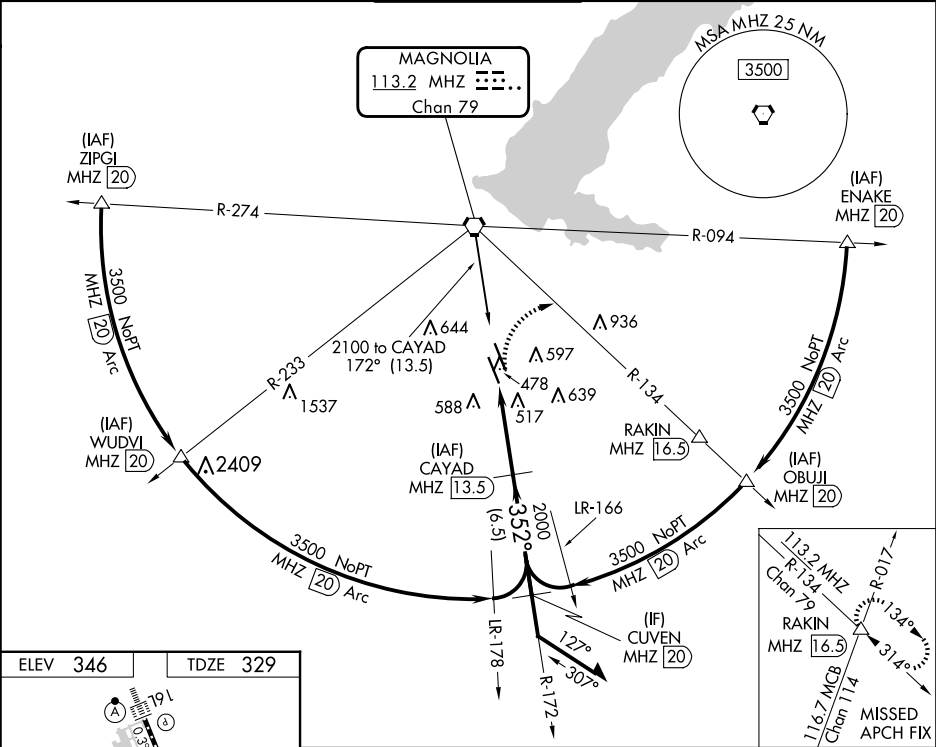

3000 hdg 120°	MHZ R-134	RAKIN △	CAYAD MHZ 13.5					Remain within 15 NM		
MHZ 8.5			MHZ 9.9	TCH 55 3.05°		2000		2100		
1.4			3.6 NM							
CATEGORY	A		B		C		D		E	
S-34L	840/55		511 (500-1)		840-1 3/8		511 (500-1 3/8)			
C CIRCLING	880-1 534 (600-1)		900-1 554 (600-1)		900-1 1/2 554 (600-1 1/2)		960-2 614 (700-2)		1040-2 1/2 694 (700-2 1/2)	

SC-4, 30 OCT 2025 to 27 NOV 2025

SC-4, 30 OCT 2025 to 27 NOV 2025