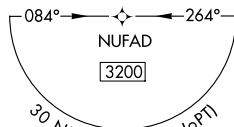
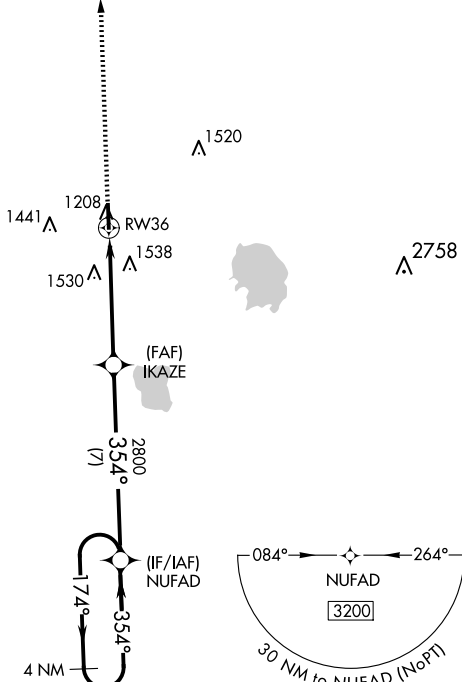
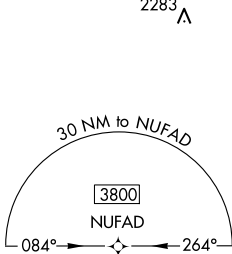
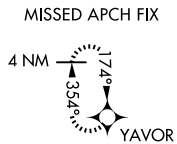


25135


RNAV (GPS) RWY 36
SUNDANCE (HSD)

MISSED APPROACH: Climb to 3600 direct YAVOR and hold.

MISSED APPROACH: Climb to 3600 direct YAVOR and hold.


UNICOM
122.7 (CTAF) **L**

TDZE 1193

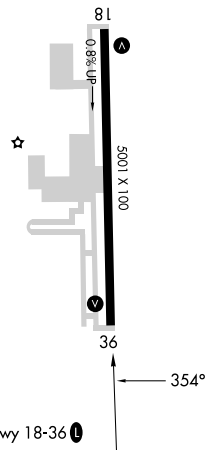

3600	YAVOR
	

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 21).

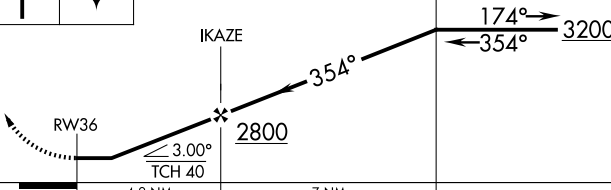4 NM
Holding Pattern

CATEGORY	4.7 NM		7 NM		D
	A	B	C		
LNAV MDA	1780-1	587 (600-1)	1780-1 ³ / ₄ 587 (600-1 ³ / ₄)	NA	
CIRCLING	1780-1 587 (600-1)	1840-1 647 (700-1)	1840-1 ³ / ₄ 647 (700-1 ³ / ₄)	NA	

SUNDANCE (HSD)
RNAV (GPS) RWY 36