


WAAS CH 78022 W05B	APP CRS 052°	Rwy Ldg 11004 TDZE 744 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5L

RICKENBACKER INTL (LCK)

RNP APCH - GPS.					MALSR	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
Circling NA northwest of Rwy 5L-23R. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 979 feet; increase LNAV/VNAV DA to 1042 feet; increase all MDAs 40 feet and Circling visibility Cat D ¼ SM.						
ATIS 132.75	COLUMBUS APP CON 134.0 279.6		RICK TOWER 120.05 348.4		GND CON 125.275 275.8	CLNC DEL 125.275 275.8

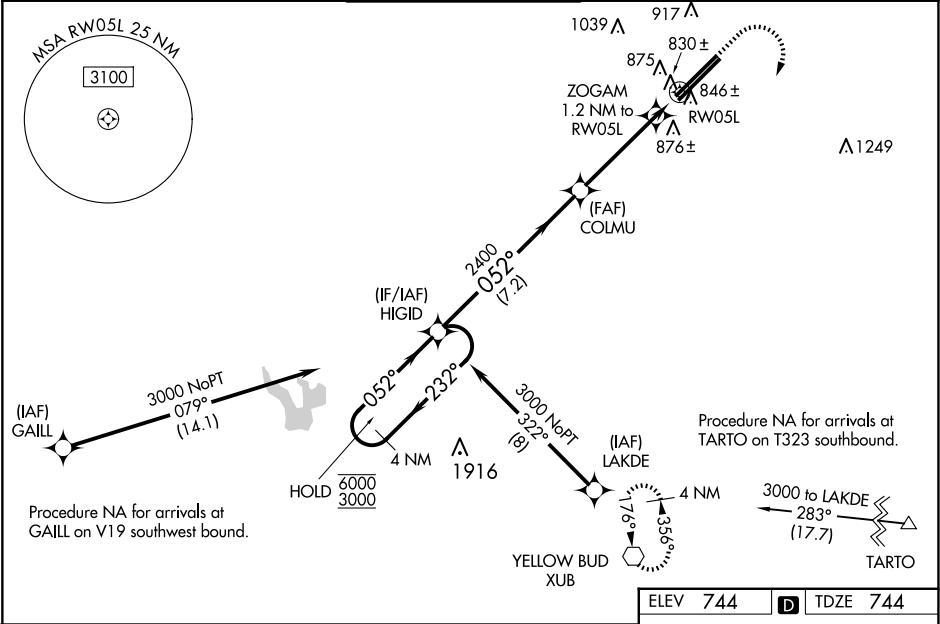

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).		ELEV 744	TDZE 744	
4 NM Holding Pattern		1500	3000	
		XUB		
CATEGORY	A	B	C	D
LPV DA	944-½		200 (200-½)	
LNAV/VNAV DA	1007-½		263 (300-½)	
LNAV MDA	1100-½	356 (400-½)	1100-5⁄8	356 (400-5⁄8)
CIRCLING	1240-1	496 (500-1)	1280-1½ 536 (600-1½)	1400-2 656 (700-2)