

TAMPA, FLORIDA

AL-9241 (FAA)

25219

WAAS CH 78100 W23A	APP CRS 226°	Rwy Ldg 4200 TDZE 21 Apt Elev 21
--	------------------------	---

RNAV (GPS) RWY 23
TAMPA EXEC (VDF)

RNP APCH-GPS.

▼ Inop table does not apply to LPV and LNAV Cat A/B. Baro-VNAV NA when using Tampa Intl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). Rwy 23 helicopter visibility reduction below $\frac{3}{4}$ SM NA. When local altimeter setting not received, use Tampa Intl altimeter setting and increase LPV DA to 323 feet, LNAV/VNAV DA to 513; increase all MDAs 40 feet, and LNAV and Circling Cat C visibilities $\frac{1}{4}$ SM. Circling Rwy 18, 36 NA at night.


MALSR



MISSED APPROACH:
Climb to 800 then climbing
left turn to 2700 direct to
LAL VORTAC and hold.


AWOS-3
121.125

TAMPA APP CON
119.9 290.3

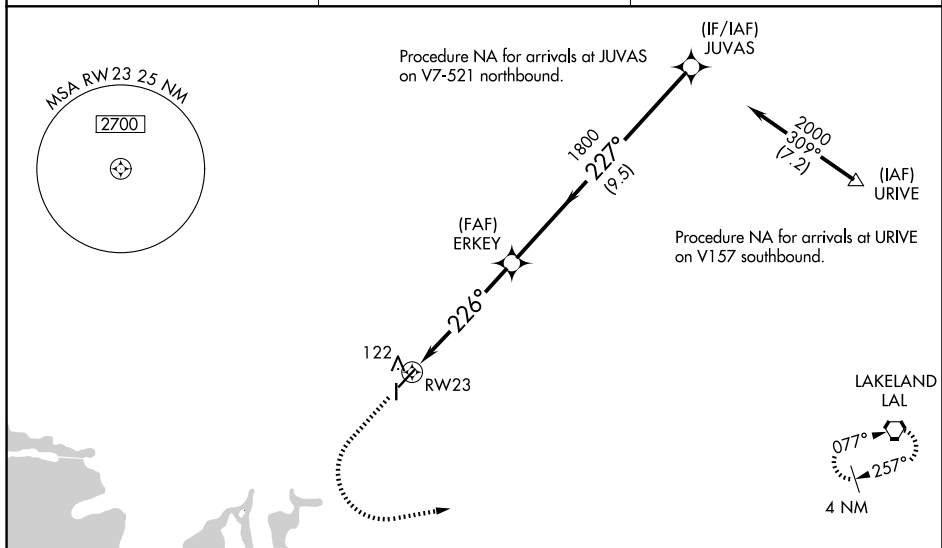UNICOM
122.7 (CTAF) **L**

SE-3, 30 OCT 2025 to 27 NOV 2025

ELEV 21	D	TDZE 21
---------	----------	---------

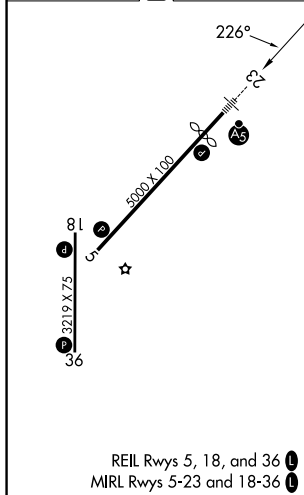

REIL Rwys 5, 18, and 36 **L**
MIRL Rwys 5-23 and 18-36 **L**

800
↑

2700
↶

LAL
⬠

RW23

ERKEY
1800

JUVAS
1800

226°

227°

5.3 NM

9.5 NM

GP 3.10°
TCH 40

Procedure
Turn
NA

TAMPA, FLORIDA

Amdt 1E 07OCT21

28°01'N-82°21'W

TAMPA EXEC (VDF)

RNAV (GPS) RWY 23