

TAMPA, FLORIDA

AL-9241 (FAA)

25219

WAAS CH 97426 W05A	APP CRS 046°	Rwy Ldg TDZE Apt Elev	4956 21 21
--	------------------------	-----------------------------	---------------------------------------


RNAV (GPS) RWY 5
TAMPA EXEC (VDF)

RNP APCH-GPS.

T Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 1°C (34°F) or above 54°C (130°F). When local altimeter setting not received, use Tampa Int'l altimeter setting and increase LPV DA to 316 feet, LNAV/VNAV DA to 507 feet; increase all MDAs 40 feet and increase LNAV and Circling Cat C visibilities $\frac{1}{4}$ SM. Baro-VNAV and VDP NA when using Tampa Int'l altimeter setting. Circling Rwy 18, 36 NA at night.



MISSED APPROACH:
Climb to 600 then climbing
right turn to 2000 direct LAL
VORTAC and hold.

AWOS-3 121.125	TAMPA APP CON 119.9 290.3	UNICOM 122.7 (CTAF) ①
--------------------------	-------------------------------------	---------------------------------

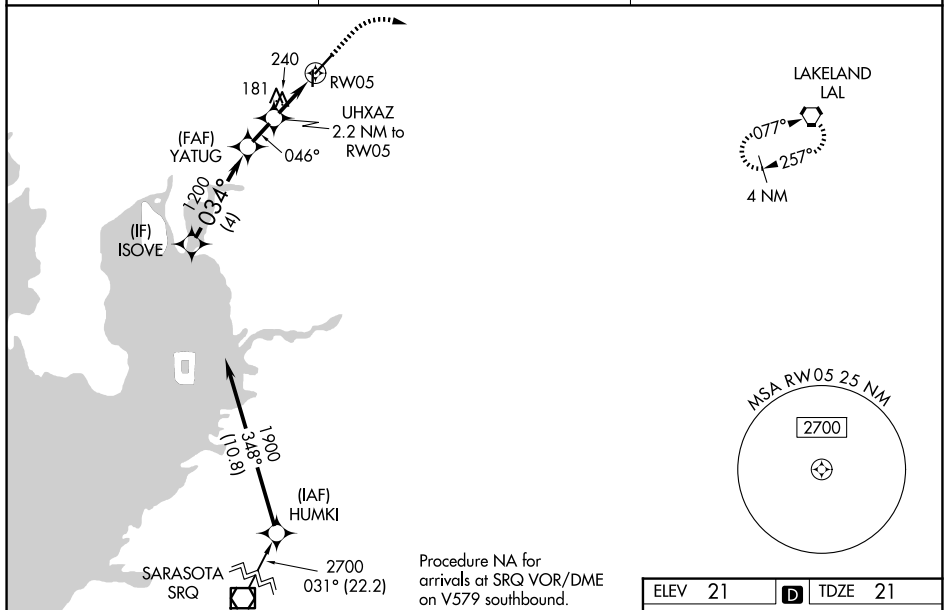

ELEV 21	D	TDZE 21
---------	----------	---------

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.02/TCH 45).

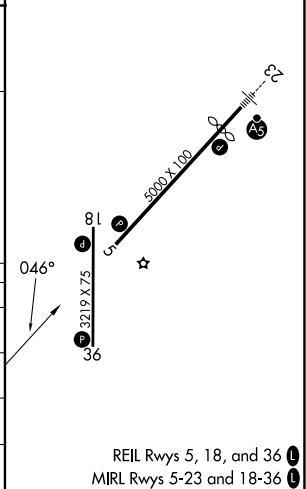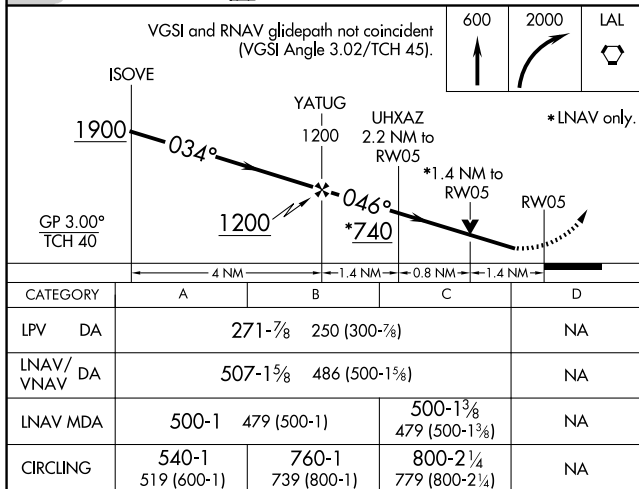

TAMPA, FLORIDA
Orig-E 07OCT21

28°01'N-82°21'W

TAMPA EXEC (VDF)

RNAV (GPS) RWY 5