

LOC I-AGS 110.5	APP CRS 352°	Rwy Ldg TDZE Apt Elev 8001 137 146	ILS or LOC RWY 35 AUGUSTA RGNL AT BUSH FLD (AGS)
---------------------------	------------------------	--	---

When local altimeter setting not received, use Daniel Fld altimeter setting and increase S-ILS 35 DA to 392; increase all MDAs 60 feet and S-LOC 35 and Circling Cats C and D visibility ¼ SM. Autopilot coupled approach NA below 940.

MALSR

MISSED APPROACH:
Climb to 600 then climbing left turn to 2100 direct IRQ VORTAC and hold.

ATIS 132.75	AUGUSTA APP CON★ 126.8 270.3	AUGUSTA TOWER★ 118.7 (CTAF) 239.3	GND CON 121.9 348.6	UNICOM 122.95
-----------------------	--	---	-------------------------------	-------------------------

MISSED APCH FIX

R-341

COLLIERS

IRQ

113.9

Chan 86

ALTERNATE MISSED APCH FIX

BUSHE AG

233


COLLIERS

113.9 IRQ

Chan 86

LOCALIZER 110.5

I-AGS

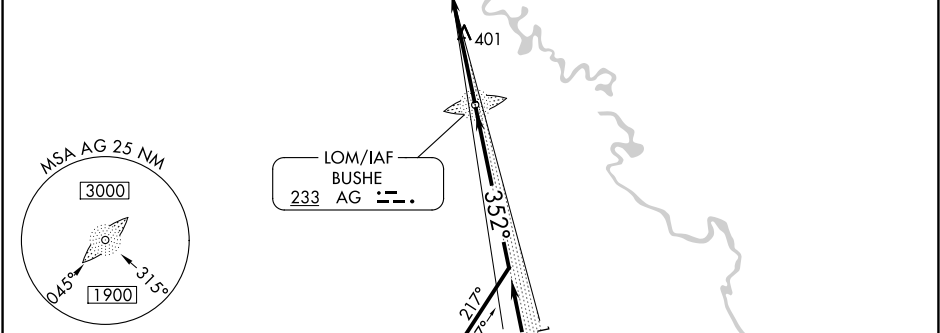

ELEV 146

TDZE 137

MIRL Rwy 8-26

HIRL Rwy 17-35

REIL Rwys 8 and 26

TWR

8001 x 1.69

6002 x 7.5

35

352°

FAF to MAP 4.5 NM

Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

600	2100	IRQ	AG LOM	1648	172°	2000	352°	1700	GS 3.00° TCH 56
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 72).									
4.5 NM									
CATEGORY	A		B		C		D		
S-ILS 35			337/24		200 (200-½)				
S-LOC 35	660/24		523 (600-½)		660/55		523 (600-1)		
CIRCLING	780-1		634 (700-1)		780-1¾ 634 (700-1¾)		940-2½ 794 (800-2½)		