

APP CRS
227°

Rwy Ldg
TDZE
Apt Elev

8000
938
956

RNAV (GPS) RWY 23

DONALDSON FLD (GYH)


▼

⚠

Rwy 23 helicopter visibility reduction below 3/4 SM NA. When local altimeter setting not received, use Greer altimeter setting and increase all MDAs 40 feet and LNAV visibility Cat C/D 1/2 SM. VDP NA when using Greer altimeter setting.

MISSED APPROACH:
Climb to 3000 direct NINYI and hold.

ATIS 127.325	GREER APP CON★ 118.8 270.275	DONALDSON TOWER★ 133.325 (CTAF) 269.25	GND CON 121.4	UNICOM 122.7
-----------------	---------------------------------	---	------------------	-----------------

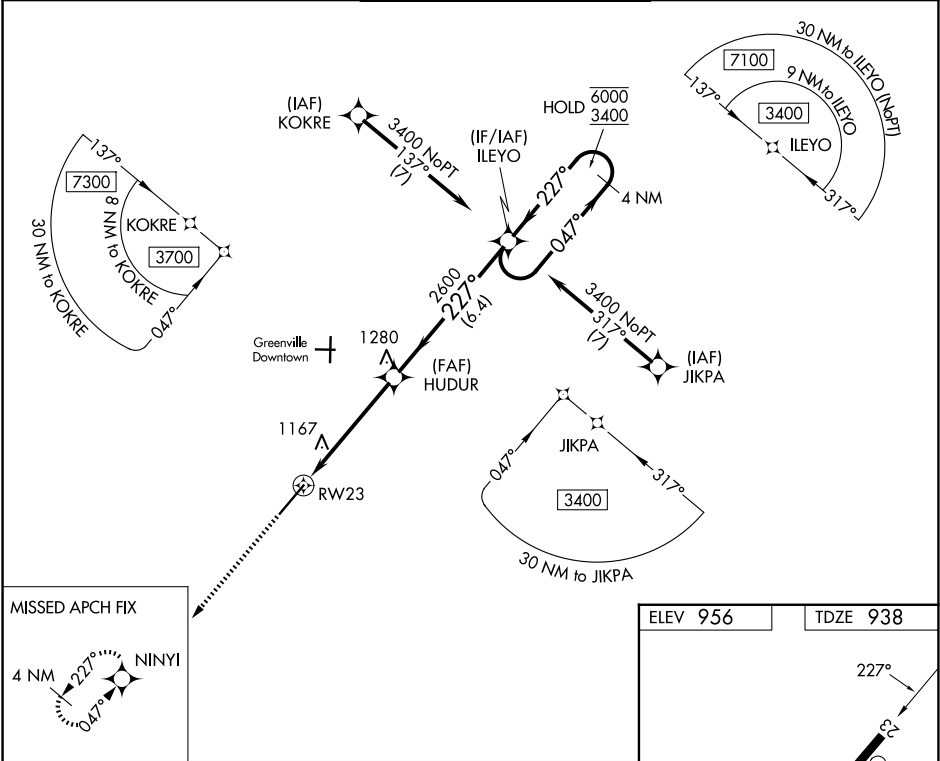

3000

NINYI

VGSI and descent angles not coincident
(VGSI Angle 4.14/TCH 95).

HUDUR

ILEYO

4 NM Holding Pattern

0.9 NM to RWY 23

0.9 NM

4.1 NM

6.4 NM

CATEGORY	A	B	C	D
LNAV MDA	1420-1	482 (500-1)	1420-1 3/8	482 (500-1 3/8)
CIRCLING	1420-1 464 (500-1)	1480-1 524 (600-1)	1480-1 1/2 524 (600-1 1/2)	1520-2 564 (600-2)

ELEV 956

TDZE 938

227°

0.3% DOWN

0.6% UP

8000 x 1.50

TWR

HIRL Rwy 5-23