

LOC/DME I-CLL
110.55
Chan **42**(Y)

APP CRS
166°

Rwy Ldg
TDZE
Apt Elev
7000
321
321

LOC BC RWY 17
EASTERWOOD FLD (CLL)

DME required.


▼

▲

Rwy 17 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climb to 2000 on heading 166° and CLL R-127 to HEDIX/CLL 14 DME and hold.

ATIS 126.85	HOUSTON APP CON 134.3 360.85	EASTERWOOD TOWER ★ 118.5 (CTAF) 0 284.7	GND CON 128.7 284.7	UNICOM 122.95
-----------------------	--	--	-------------------------------	-------------------------

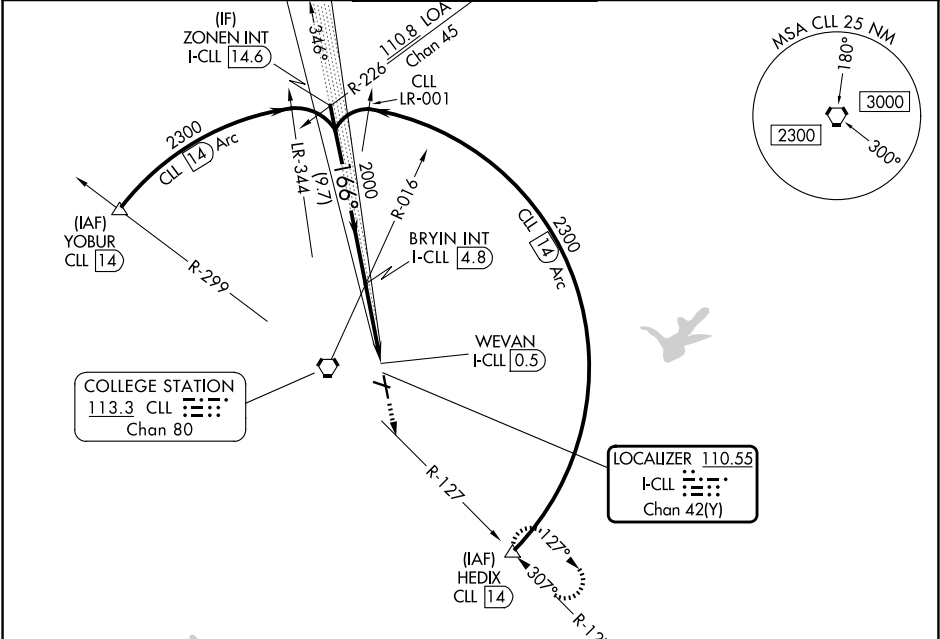

BACK COURSE

ELEV 321 TDZE 321

166°
11
TWR
5158 X 130
7000 X 46
35

Use I-CLL DME when on the localizer course.

2000 hdg 166° and CLL R-127 HEDIX

ZONEN INT I-CLL 14.6

BRYIN INT I-CLL 4.8

I-CLL 1.5

WEVAN I-CLL 0.5

2300

166°

3.04° TCH 51

2000

Disregard glideslope indications.

9.7 NM 3.3 NM 1 NM 0.7

CATEGORY	A	B	C	D	E
S-LOC 17	940-1	619 (700-1)	940-1¾	619 (700-1¾)	
CIRCLING	940-1	619 (700-1)	1000-2 679 (700-2)	1180-2¾ 859 (900-2¾)	1180-3 859 (900-3)

REIL Rwy 29
MIRL Rwy 11-29
HIRL Rwy 17-35

FAF to MAP 4.3 NM

Knots	60	90	120	150	180
Min:Sec	4:18	2:52	2:09	1:43	1:26