
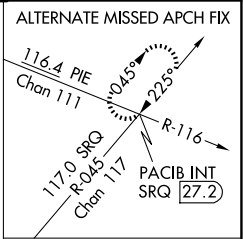


LOC/DME I-LAL 110.1 Chan 38	APP CRS 096°	Rwy Ldg TDZE 132 Apt Elev 142
---	------------------------	---



ILS RWY 10 (SA CAT I)
LAKELAND LINDER INTL (LAL)

DME required.	ALSIF-2	MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 on heading 292° and on LAL VORTAC R-330 to PLUMY INT/PIE 33.4 DME and hold.
Requires specific OPSPEC, MSPEC, or LOA approval.		

ATIS 118.025	TAMPA APP CON 120.65 290.3	LAKELAND TOWER 124.5 236.775	GND CON 121.4
------------------------	--------------------------------------	--	-------------------------

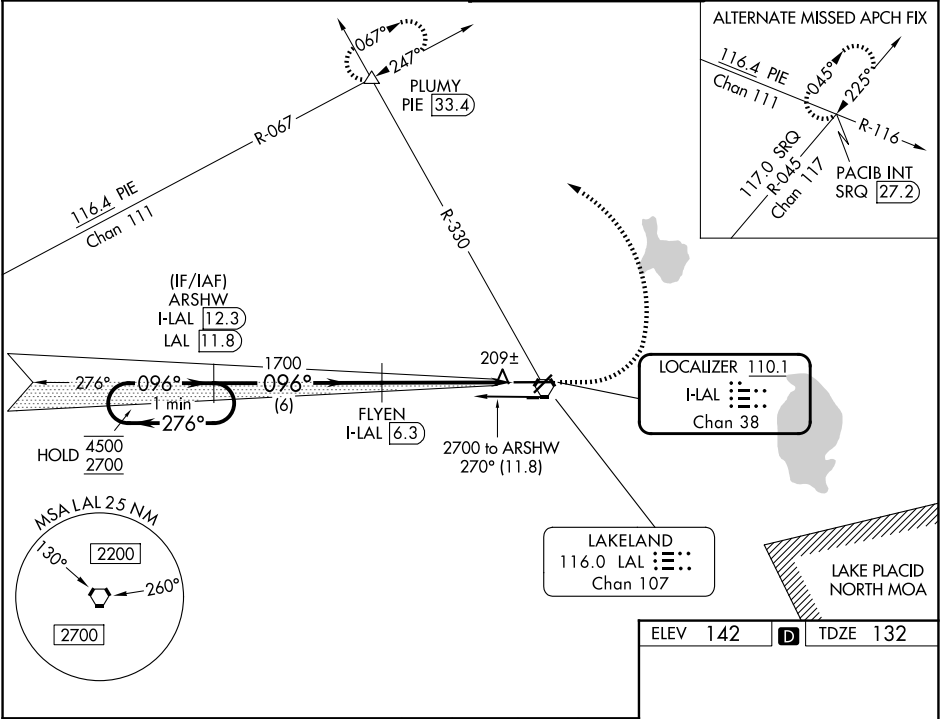

ELEV 142	D	TDZE 132
-----------------	----------	-----------------

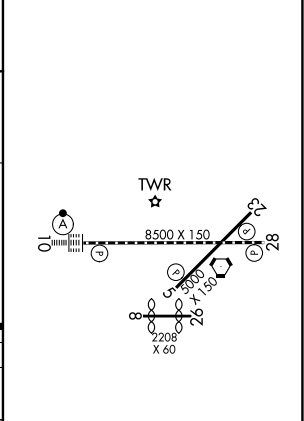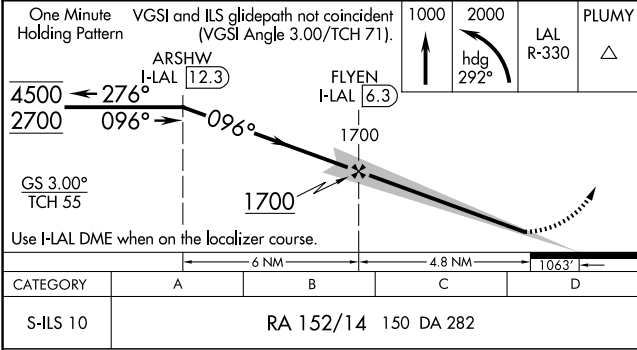

CATEGORY	A	B	C	D
S-ILS 10	RA 152/14 150 DA 282			

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

TDZ/CL Rwy 10
HIRL Rwy 5-23 and 10-28