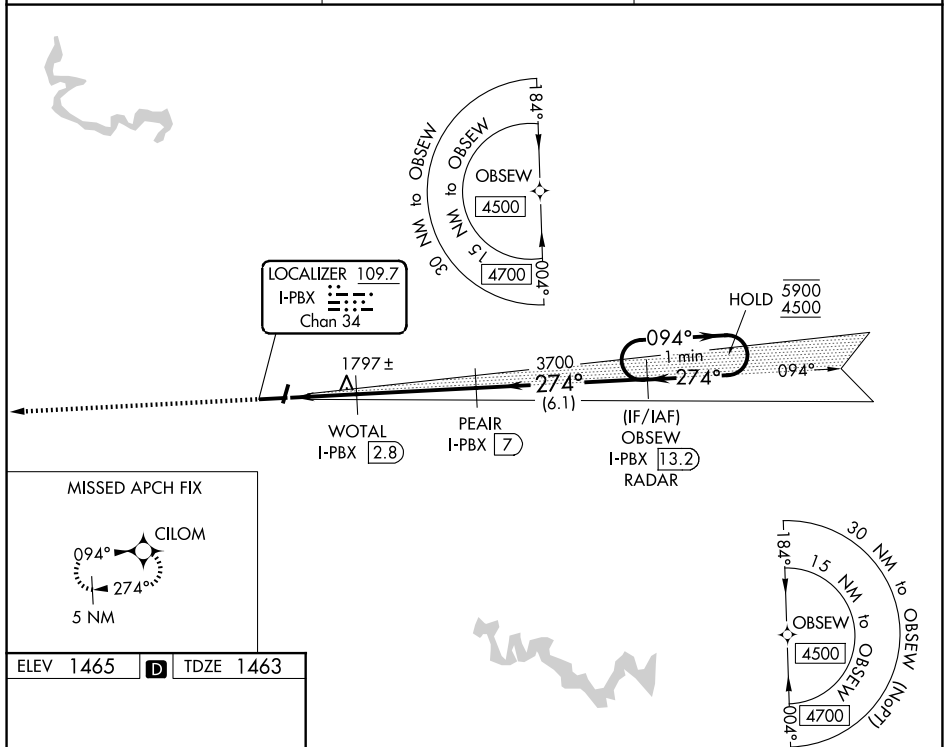



25219

ILS or LOC RWY 27  
PIKE COUNTY/HATCHER FLD (PBX)

**MISSED APPROACH:** Climb to 4500 direct CILOM and hold, continue climb-in-hold to 4500.

UNICOM  
122.8 (CTAF) **L**

A diagram of a bent beam. The beam is divided into two segments. The left segment is horizontal and has a length of 53.56 X 100. It is supported by a pin support at the left end and a roller support at the right end. A downward force of 34.55 X 7.5 is applied at the right end of the horizontal segment. The right segment of the beam is inclined upwards at an angle of 274 degrees relative to the horizontal. It has a length of 34.55 X 7.5. A downward force of 0.3% UP is applied at the end of the inclined segment. A star symbol is located at the joint between the two segments.

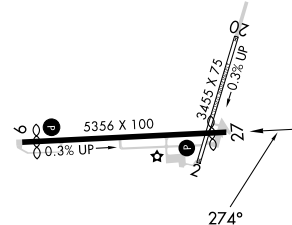

|                                                                    |                       |                                                                                                                 |                                                                             |                        |  |
|--------------------------------------------------------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------|------------------------|--|
| 4500<br>↑                                                          | CILOM<br>✦            | PEAIR<br>I-PBX (7)<br>WOTAL<br>I-PBX (2.8)<br>3700<br>274°<br>094° → 5900<br>← 274° 4500<br>GS 3.00°<br>TCH 47° |                                                                             |                        |  |
| I-PBX (0.2)<br>I-PBX (1.9)<br>1.8 NM<br>0.8 NM<br>4.3 NM<br>6.1 NM |                       |                                                                                                                 |                                                                             |                        |  |
| CATEGORY                                                           | A                     | B                                                                                                               | C                                                                           | D                      |  |
| S-ILS 27                                                           | 1722-1                |                                                                                                                 | 259 (300-1)                                                                 |                        |  |
| S-LOC 27                                                           | 2080-1 617 (700-1)    |                                                                                                                 | 2080-1 <sup>3</sup> / <sub>4</sub> 617 (700-1 <sup>3</sup> / <sub>4</sub> ) |                        |  |
| CIRCLING                                                           | 2120-1<br>655 (700-1) | 2180-1<br>715 (800-1)                                                                                           | 2180-2<br>715 (800-2)                                                       | 2460-3<br>995 (1000-3) |  |

PIKE COUNTY/HATCHER FLD (PBX)  
ILS or LOC RWY 27

37°34'N-82°34'W