

TACAN Y RWY 32

TACAN EIL Chan 98	APCH CRS 320°	Rwy lgt 14,529 TDZE 548 Arpt Elev 548
----------------------	------------------	---

[USAF]

EIELSON AFB (PAEI)

ATC or RADAR required HRDNG to BOGIE. RNAV or RADAR monitoring required for missed approach.


▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE vis to 1½ miles.
** Circling not authorized E of Rwy 14-32.



MISSED APPROACH: Climbing left turn on EIL R-249 to 4000 to WAKOV and hold. Continue climb-in-hold.

ATIS ★ 119.9 273.5	FAIRBANKS APP CON 127.1 251.1 360°-179° 125.35 363.2 180°-359°	TOWER ★ 127.2 352.05	GND CON 121.8 275.8	CLNC DEL 343.7
-----------------------	--	-------------------------	------------------------	-------------------

CAUTION: Uncontrolled airspace below 700' AGL outside EIL CLASS D.

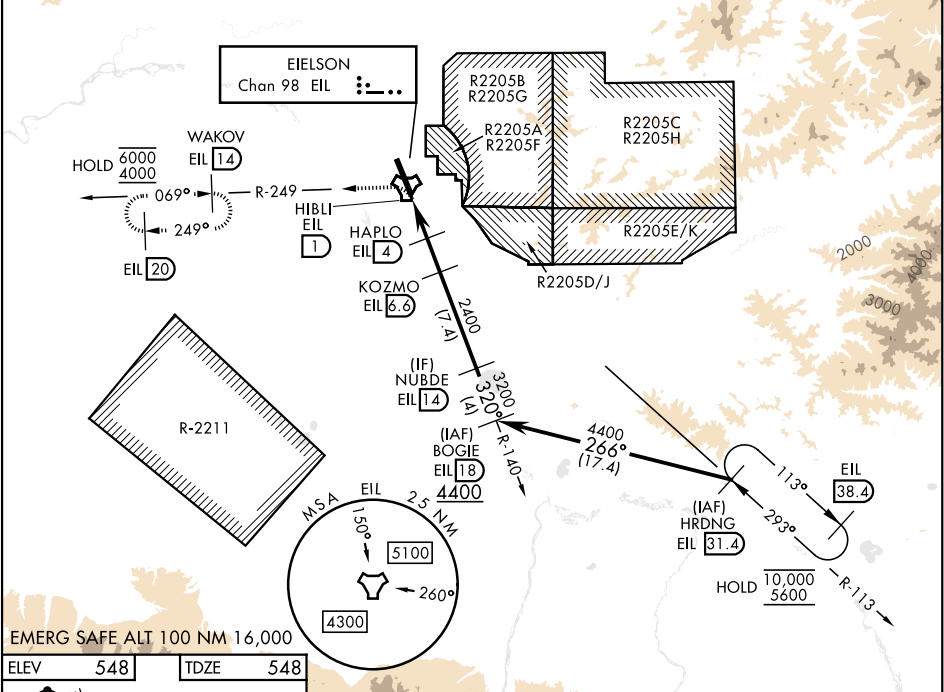

Rwy lgt on N 11,314° of rwy 300' wide, rwy lgt on S 3200' of rwy 150' wide. HIRL Rwy 14-32 14,529 x 150 TWR 32° 320° A1 P ☆	4000 EIL R-249 WAKOV EIL 14 EIL TACAN HIBLI EIL 1 HAPLO EIL 4 KOZMO EIL 6.6 NUBDE EIL 14 2.78° TCH 44 320° 3200 2400 1600 0.5 3 NM 2.6 NM				
CATEGORY	A	B	C	D	E
S-32 *	1040/24 492 (500-½)		1040/50 492 (500-1)		
CIRCLING **	1040-1 492 (500-1)		1040-1½ 492 (500-1½)	1280-2¼ 732 (800-2¼)	1280-2½ 732 (800-2½)

TACAN Y RWY 32