

VORTAC GXU 110.6 Chan 43	APCH CRS 179°	Rwy Ildg TDZE Arpt Elev 7126 123 141
--	-------------------------	--

[USAF]

(JOINT BASE MC GUIRE DIX LAKEHURST) (KWRI)


MC GUIRE FLD,

RADAR required when R-5001 and/or R-5002 is active.

MISSED APPROACH: Climb to 2000 via GXU VORTAC R-130 to LADBE and hold, DO NOT turn prior to GXU.

* Circling NA SE of RWY 24 and E of RWY 36 when R-5001 A/B active.

ATIS 110.6 270.1	MC GUIRE APP CON/DEP CON 126.475 363.8	TOWER 118.65 255.6	GND CON 121.8 275.8	PAR
----------------------------	--	------------------------------	-------------------------------	-----

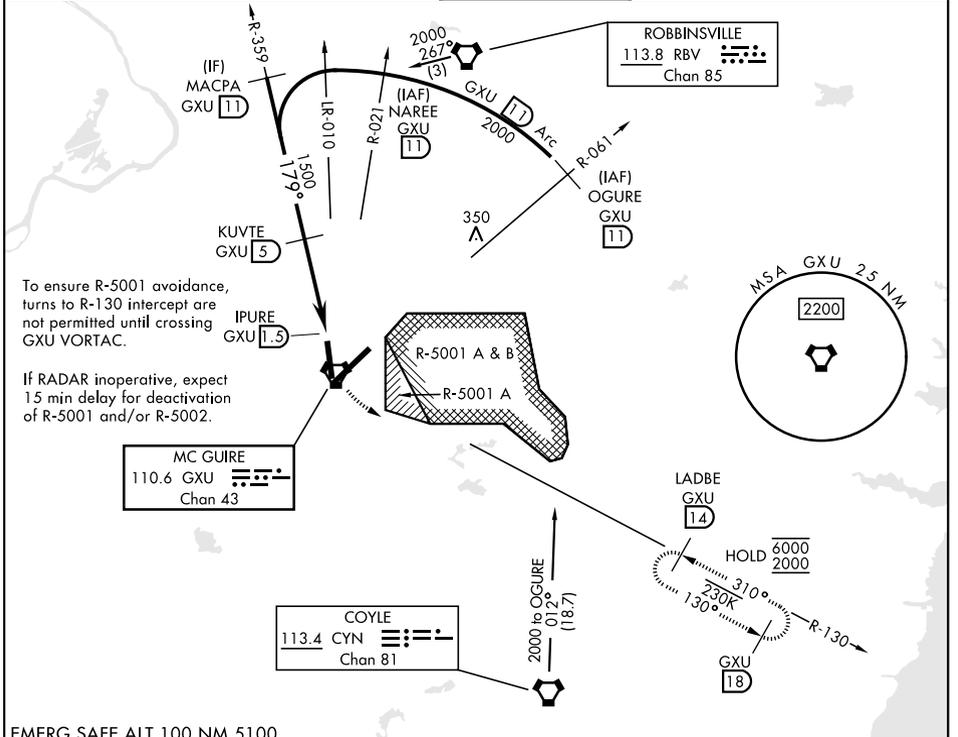

To ensure R-5001 avoidance, turns to R-130 intercept are not permitted until crossing GXU VORTAC.


If RADAR inoperative, expect 15 min delay for deactivation of R-5001 and/or R-5002.

NE-2, 19 MAR 2026 to 16 APR 2026

NE-2, 19 MAR 2026 to 16 APR 2026

EMERG SAFE ALT 100 NM 5100

	OGURE R-061 GXU 11	NAREE R-021 GXU 11	MACPA R-359 GXU 11	KUVTE GXU 5	GXU 2.5	IPURE GXU 1.5	LADBE GXU 14	ELEV 141	TDZE 123
	2000				2000	179°	1500	2000	2000
	2000				2000	3.18°	TCH 68		
					3.5 NM	0.4			
CATEGORY	A	B	C	D	E				
S-18	640-1	517 (500-1)	640-1½	517 (500-1½)					
CIRCLING *	680-1	539 (600-1)	700-1½ 559 (600-1½)	700-2 559 (600-2)	1200-3 1059 (1100-3)				

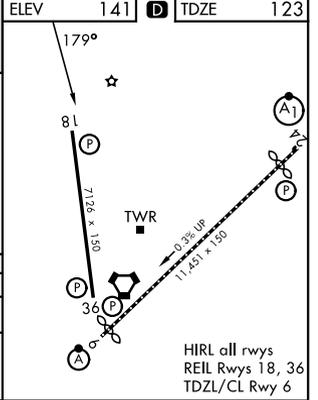

HIRL all rwys
REIL Rwy 18, 36
TDZL/CL Rwy 6