

LOC/DME I-PWM 109.9 Chan 36	APP CRS 110°	Rwy Ldg 7200 TDZE 76 Apt Elev 76
---	------------------------	---

ILS RWY 11 (CAT II & III)


PORTLAND INTL JETPORT (PWM)

Procedure NA when control tower closed.

ALSF-2

MISSED APPROACH: Climb to 600 then climbing right turn to 3000 direct ENE VOR/DME and hold.

ATIS 119.05	PORTLAND APP CON * 119.75 269.35	PORTLAND TOWER * 120.9 (CTAF) 257.8	GND CON 121.9	UNICOM 122.95
-----------------------	--	--	-------------------------	-------------------------

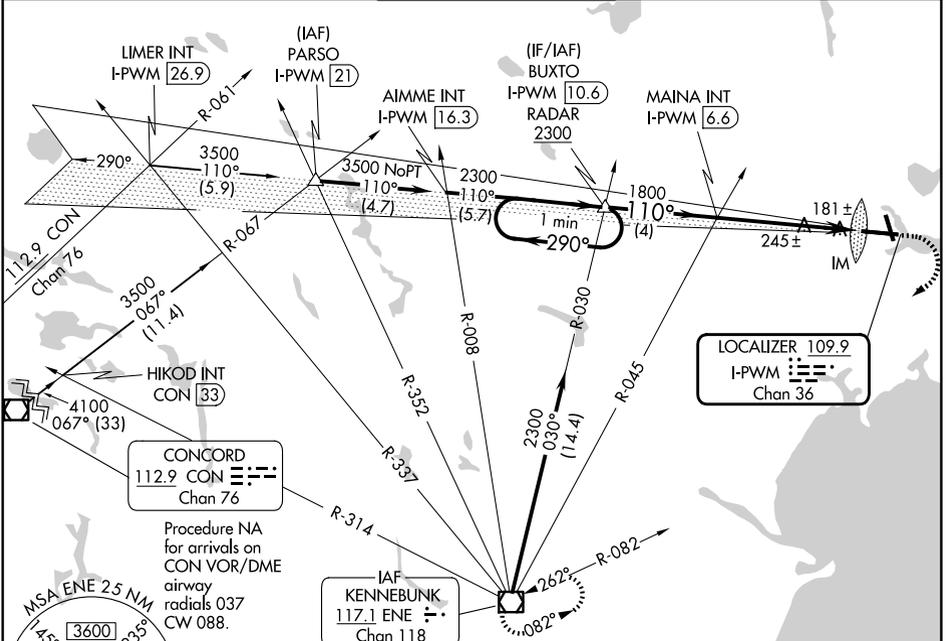



NE-1, 19 MAR 2026 to 16 APR 2026

NE-1, 19 MAR 2026 to 16 APR 2026

Procedure NA for arrivals on CON VOR/DME airway radials 037 CW 088.

Procedure NA for arrivals on ENE VOR/DME airway radial 062.

ELEV 76	TDZE 76
---------	---------

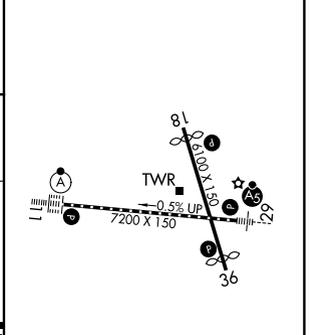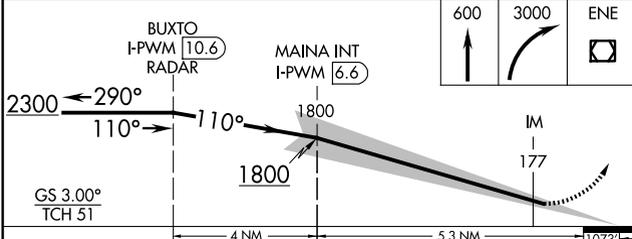

CATEGORY	A	B	C	D
S-ILS 11	CAT II RA 108/12 100 DA 176			
S-ILS 11	CAT III RVR 06			

- TDZL/RCLS Rwy 11
- MIRL Rwy 18-36
- HIRL Rwy 11-29
- REIL Rwy 18 and 36

CATEGORY II & III ILS-SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED