





| | |
|------------------------|----------------------|
| APP CRS 344° | Rwy Ldg 11901 |
| | TDZE 372 |
| | Apt Elev 432 |

RNAV (RNP) Z RWY 34R

SEATTLE-TACOMA INTL (SEA)

| | | |
|--|--------|--|
| RNP AR APCH. | MALSRL | MISSED APPROACH: Climb to 5000 on track 344° to CASDA and on track 343° to MGNUM and hold, continue climb-in-hold to 5000. |
| <p>▼ Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -6°C or above 54°C. Use of FD or AP required during simultaneous operations. For inop ALS, increase RNP 0.28 all Cats visibility to 1½ SM. Inop table does not apply to RNP 0.30.</p> | | |

| | | | |
|------------------------|---|--|-------------------------|
| D-ATIS 118.0 | SEATTLE APP CON 133.65 273.45 | SEATTLE TOWER 119.9 239.3 (16L, 16C, 34C, 34R) 120.95 239.3 (16R, 34L) | GND CON 121.7 |
|------------------------|---|--|-------------------------|

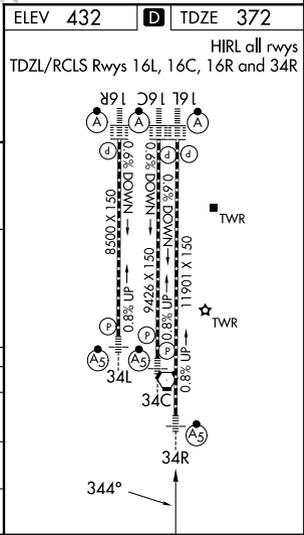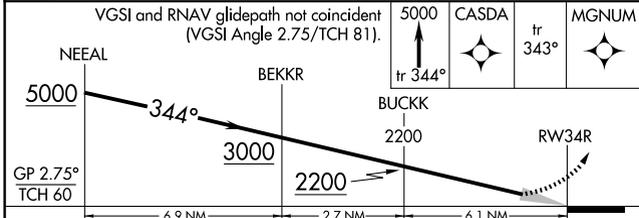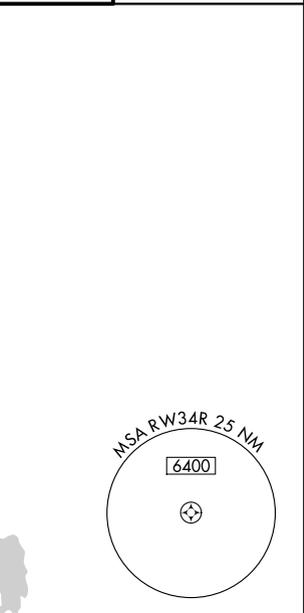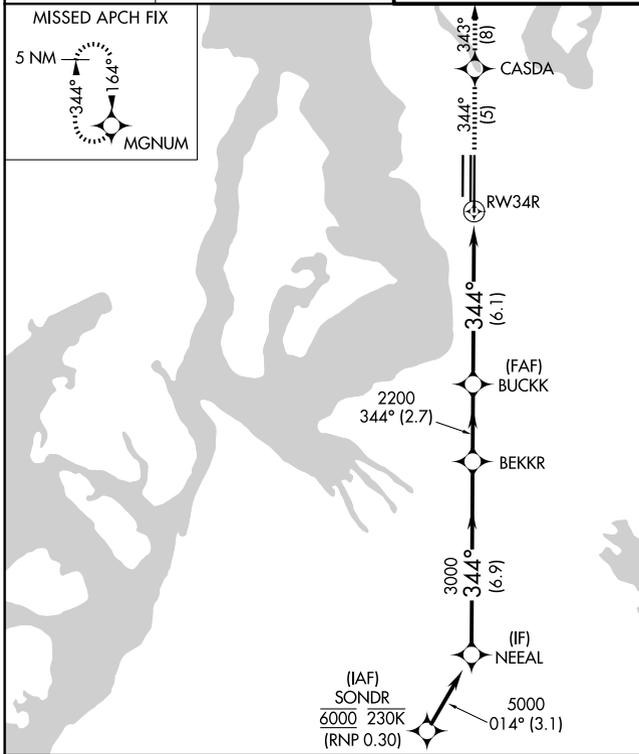

| | | | | |
|-------------|---|--------|--------------|---|
| CATEGORY | A | B | C | D |
| RNP 0.28 DA | | 867/50 | 495 (500-1) | |
| RNP 0.30 DA | | 880-1½ | 508 (500-1½) | |

AUTHORIZATION REQUIRED