


LOC/DME I-TBQ 110.1 Chan 38	APP CRS 337°	Rwy Ldg TDZE Apt Elev 6431 645 645
---	------------------------	--

ILS or LOC RWY 34



ADDISON (ADS)

RADAR required for procedure entry. DME required.		MISSED APPROACH: Climb to 1500 then climbing right turn to 5000 on heading 067° and CVE VOR/DME R-046 to FINGR/CVE 36.4 DME and hold.
Rwy 34 helicopter visibility reduction below 3/4 SM NA.		

ATIS 133.4	LONE STAR APP CON 124.3 282.275	ADDISON TOWER ★ 126.0 (CTAF) 239.0	GND CON 121.6	UNICOM 122.95
----------------------	---	--	-------------------------	-------------------------

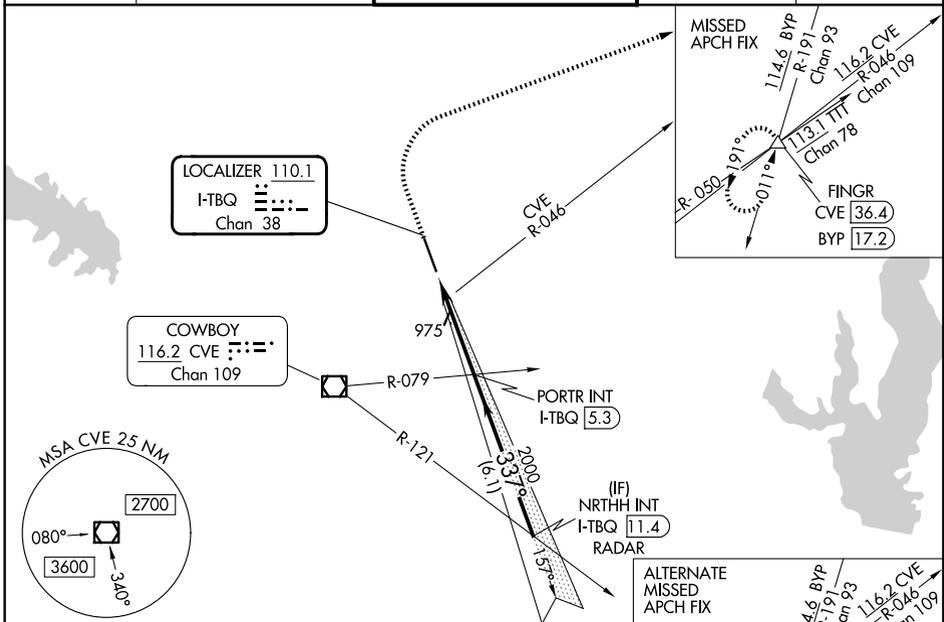

ELEV 645	D	TDZE 645
-----------------	----------	-----------------

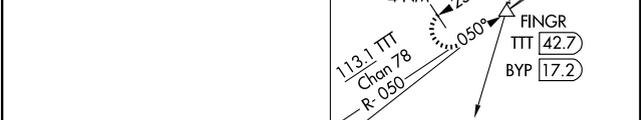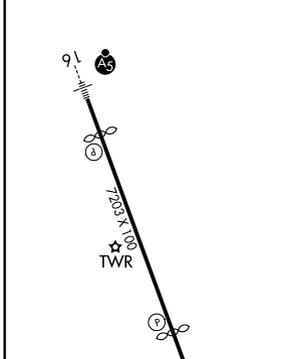

1500	5000	CVE R-046	FINGR	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 60).	NRTHH INT I-TBQ 11.4
hdg 067°				PORTR INT I-TBQ 5.3	RADAR
				2000	2500
				I-TBQ 2.9	GS 3.00°
				1.7 NM	TCH 54

REIL Rwy 34 HIRL Rwy 16-34	FAF to MAP 4.1 NM	337°			
Knots	60	90	120	150	180
Min:Sec	4:06	2:44	2:03	1:38	1:22
CATEGORY	A	B	C	D	
S-ILS 34	895-3/4		250 (300-3/4)		
S-LOC 34	1240-1 595 (600-1)		1240-1 3/4 595 (600-1 3/4)		