
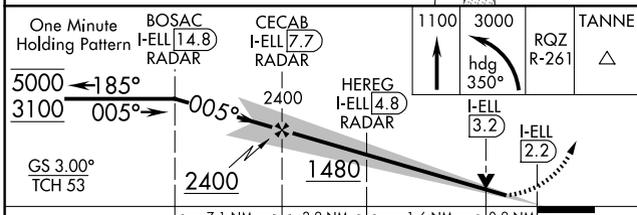
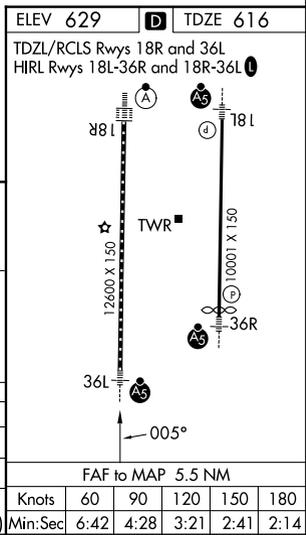


LOC/DME I-ELL 108.5 Chan 22	APP CRS 005°	Rwy Ldg 12600 TDZE 616 Apt Elev 629
---	------------------------	--

ILS or LOC RWY 36L

HUNTSVILLE INTL-CARL T JONES FLD (HSV)

DME required. RADAR required for procedure entry.		MALSR 	MISSED APPROACH: Climb to 1100 then climbing left turn to 3000 on heading 350° and RQZ R-261 to TANNE/RQZ 17.6 DME and hold.	
ATIS 121.25	HUNTSVILLE APP CON★ 125.6 354.1	HUNTSVILLE TOWER★ 127.6 (CTAF) 350.35	GND CON 121.9 269.525	UNICOM 122.95

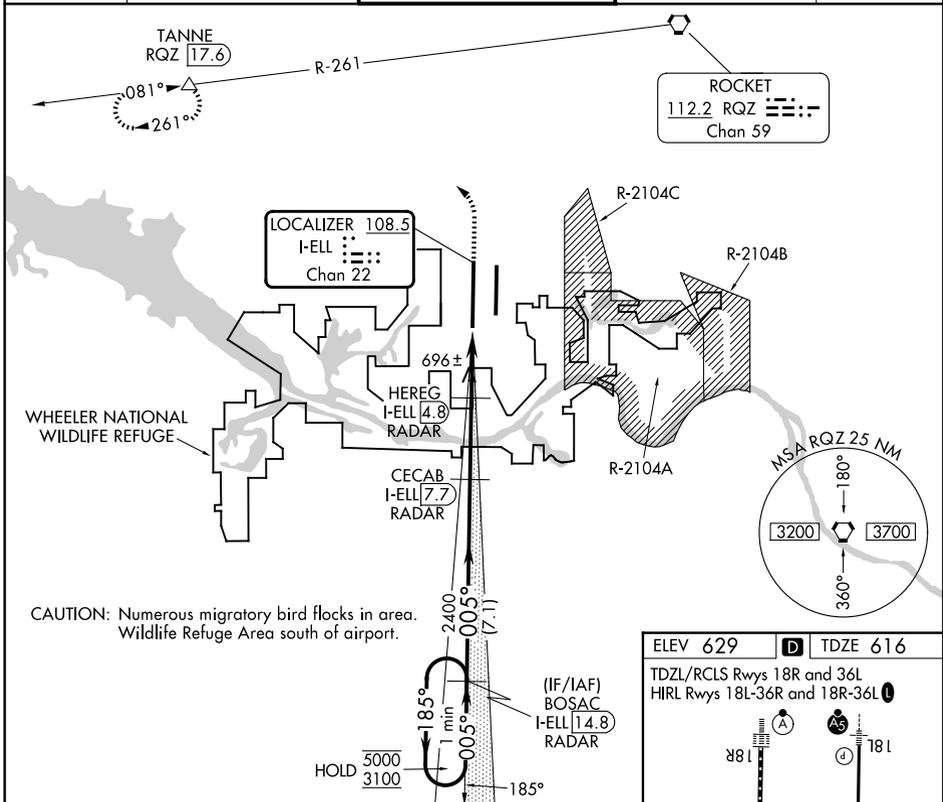

CATEGORY	A	B	C	D	E
S-ILS 36L	816/18 200 (200-½)				
S-LOC 36L	960/24	344 (400-½)	960/30	344 (400-¾)	
CIRCLING	1160-1	531 (600-1)	1160-1½ 531 (600-½)	1240-2 611 (700-2)	1260-2¼ 631 (700-2¼)

FAF to MAP 5.5 NM	Knots	60	90	120	150	180
	Min:Sec	6:42	4:28	3:21	2:41	2:14

SE-4, 19 MAR 2026 to 16 APR 2026

SE-4, 19 MAR 2026 to 16 APR 2026