


WAAS CH 61113 W33A	APP CRS 334°	Rwy Ldg TDZE 2281 Apt Elev 2284
--	------------------------	---

RNAV (GPS) RWY 33

JOHN MURTHA JOHNSTOWN/CAMBRIA COUNTY (JST')

RNP APCH.			MALSR	MISSED APPROACH: Climb to 4800 direct LEDBE and hold.
Inop table does not apply to LNAV Cat D. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. For inop ALS increase LNAV/VNAV all Cats visibility to ½ SM and LNAV Cat C visibility to 1 SM.			A5	
ATIS 118.325	JOHNSTOWN APP CON ★ 121.2 299.2	JOHNSTOWN TOWER ★ 125.75 (CTAF) 0	GND CON 121.6	UNICOM 122.95

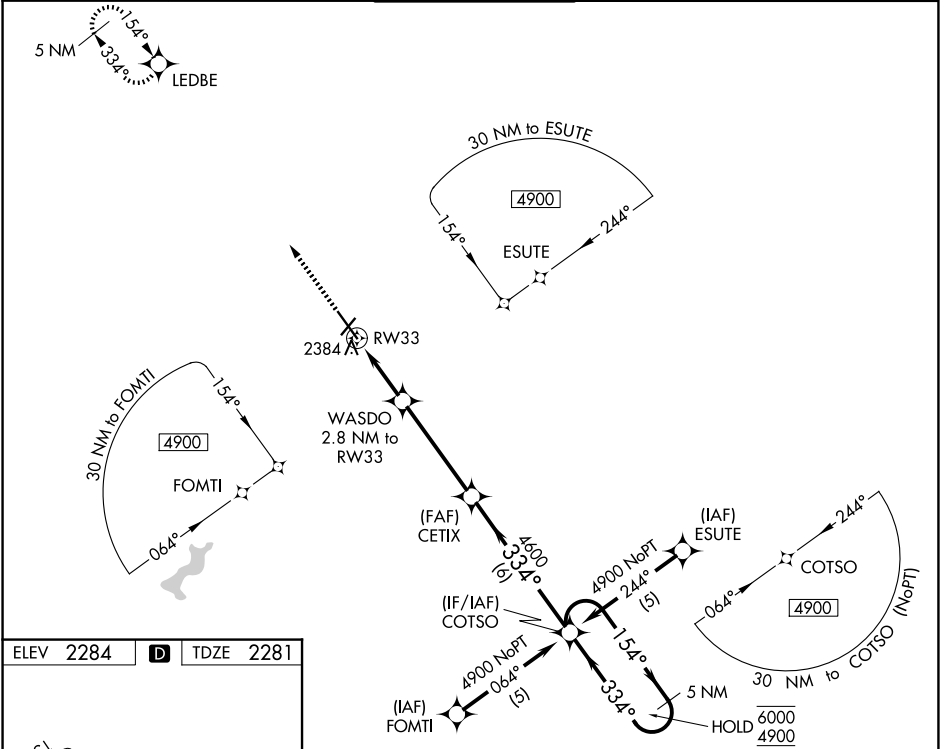

4800 LEDBE		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 53).		5 NM Holding Pattern
*LNAV only		WASDO 2.8 NM to RW33	CETIX 4600	COTSO 154° 6000 334° 4900
1 NM 1.8 NM 4.2 NM 6 NM		GP 3.00° TCH 58		
CATEGORY	A	B	C	D
LPV DA	2481-1½		200 (200-½)	
LNAV/VNAV DA	2552-½		271 (300-½)	
LNAV MDA	2640-½	359 (400-½)	2640-5/8 359 (400-5/8)	2640-1 359 (400-1)
CIRCLING	2700-1 416 (500-1)	2880-1 596 (600-1)	2880-1½ 596 (600-½)	3000-2¼ 716 (800-2¼)