



APP CRS	Rwy Ldg	5400
092°	TDZE	225
	Apt Elev	225

RNAV (GPS) RWY 9
PRATTVILLE/GROUBY FLD (1A9)

RNP APCH.	MISSED APPROACH: Climbing left turn to 3100 direct ANWAF and hold.
Rwy 9 helicopter visibility reduction below 1 SM NA. When local altimeter setting not received, use Montgomery Rgnl (Dannelly Fld) altimeter setting and increase all MDA 40 feet; increase LNAV Cats C/D visibility ½ SM. Straight-in Rwy 9 NA at night.	

AWOS-3P 118.025	MONTGOMERY APP CON ★ 121.2 269.05	GCO 121.725	UNICOM 122.8 (CTAF) 0
--------------------	--------------------------------------	----------------	--------------------------

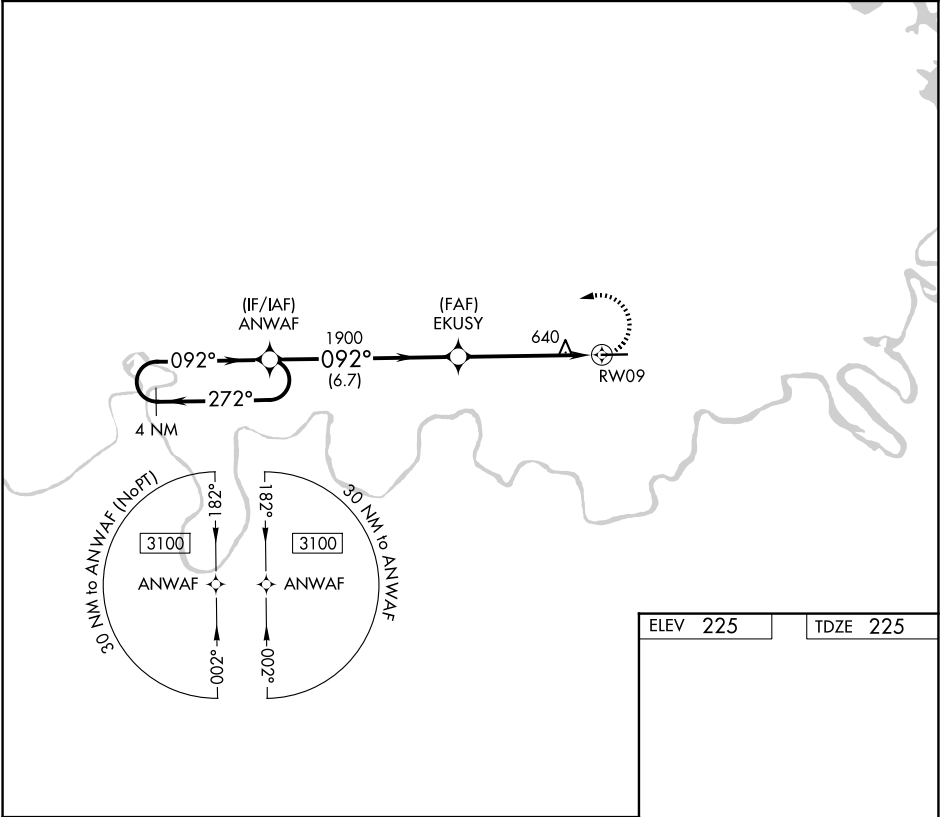

4 NM Holding Pattern		Visual Segment - Obstacles.		3100	ANWAF		
3100 ← 272° → 092°		ANWAF	092°	EKUSY	1900	RW09	
		6.7 NM		5.1 NM			
CATEGORY	A		B		C		D
LNAV MDA	980-1 755 (800-1)		980-1¼ 755 (800-1¼)		980-2		755 (800-2)
MIRL Rwy 9-27  REIL Rwy 9 and 27 							