

GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 8

TACAN GSB	APCH CRS	Rwy Idg	11,760
Chan 112	081°	TDZE	73
		Arpt Elev	109

[USAF]


SEYMOUR JOHNSON AFB (KGSB)

▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1½ miles.
** Circling N of Rwy 8-26 not authorized.

ALSF-1

MISSED APPROACH: Climb to 2300 via GSB R-081 to ZILOB and hold.

ATIS ★	APP CON	TOWER ★	GND CON
317.625	123.7 290.9 (258°-110°) 119.7 273.6 (111°-257°)	126.25 370.875	132.45 275.8

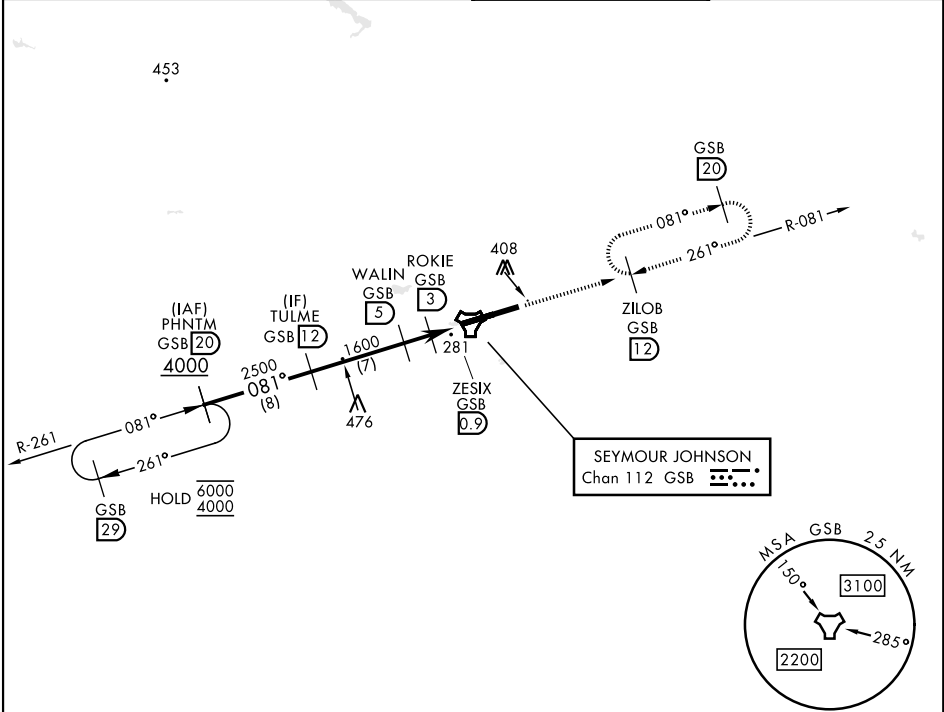

EMERG SAFE ALT 100 NM 3700					ELEV 109	TDZE 73
CATEGORY	A	B	C	D	E	
S-8 *	540/24 467 (500-½)		540/50 467 (500-1)			
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1½ 571 (600-1½)	740-2 631 (700-2)	740-2¼ 631 (700-2¼)	HIRL Rwy 8-26

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SEYMOUR JOHNSON AFB (KGSB)

Amtd 8 03NOV22

TACAN Y RWY 8

SE-2, 06 AUG 2026 to 03 SEP 2026

SE-2, 06 AUG 2026 to 03 SEP 2026