

LOC/DME I-PWM 109.9 Chan 36	APP CRS 110°	Rwy Ldg 7200 TDZE 76 Apt Elev 76
---	------------------------	---



ILS RWY 11 (CAT II & III)
PORTLAND INTL JETPORT (PWM)

Procedure NA when control tower closed.

ALSF-2

MISSED APPROACH: Climb to 600 then climbing right turn to 3000 direct ENE VOR/DME and hold.

ATIS 119.05	PORTLAND APP CON ★ 119.75 269.35	PORTLAND TOWER ★ 120.9 0 (CTAF) 257.8	GND CON 121.9	UNICOM 122.95
-----------------------	--	---	-------------------------	-------------------------

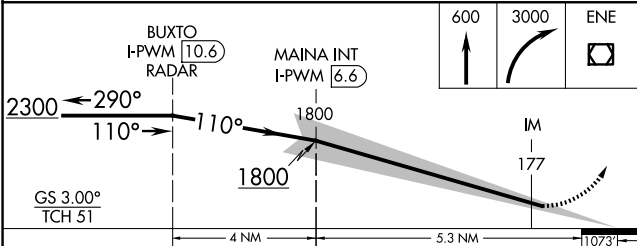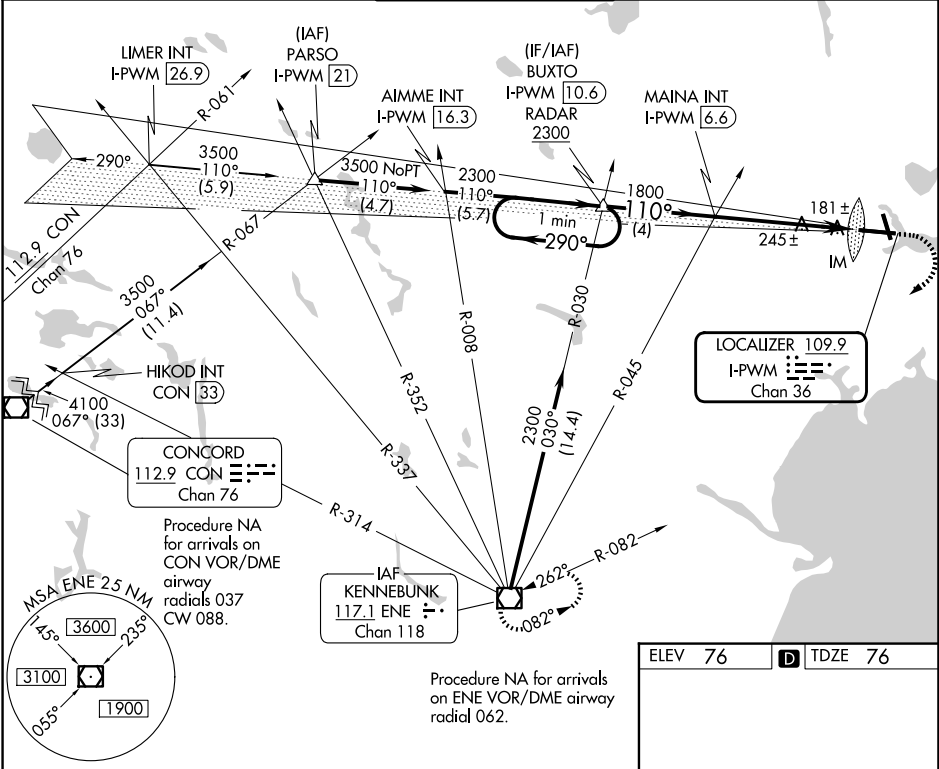

CATEGORY	A	B	C	D
S-ILS 11	CAT II	RA 108/12	100 DA 176	
S-ILS 11		CAT III	RVR 06	

CATEGORY II & III ILS-SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ELEV 76 TDZE 76

TDZL/RCLS Rwy 11 0

MIRL Rwy 18-36 0

HIRL Rwy 11-29 0

REIL Rwy 18 and 36 0