

25275

RNAV (GPS) RWY 5

JOHN MURTHA JOHNSTOWN/CAMBRIA COUNTY (JST)

T When local altimeter setting not received, procedure NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 29°C. Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA.

MISSED APPROACH: Climb to 4900 direct REPTC and hold.


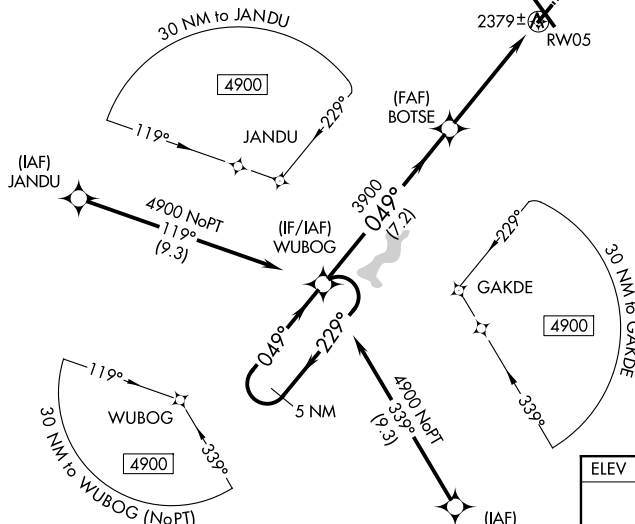
UNICOM
122.95

Diagram illustrating a missed APCH FIX. The diagram shows a star symbol representing the fix. A dashed line extends from the star at a bearing of 049°. A solid line extends from the star at a bearing of 229°. A curved line with an arrow indicates a 5 NM distance from the star.

ELEV 2284	D	TDZE 2284
-----------	----------	-----------

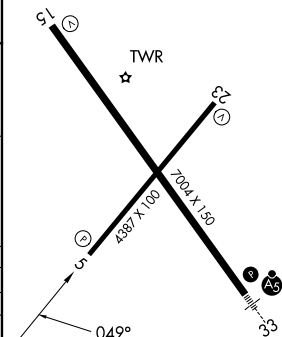

REIL Rwy 5 and 23
HIRL Rwy 15-33 **L**
MIRL Rwy 5-23 **L**

5 NM Holding Pattern

WUBOG

4900

229°

049°

GP 3.00° TCH 39°

3900

7.2 NM

5 NM

RW05

REPT

JOHNSTOWN, PENNSYLVANIA
Amdt 2C 02OCT25

JOHN MURTHA JOHNSTOWN/CAMBRIA COUNTY (JST)
40°19'N-78°50'W PNAY (GPS) PWY 5

RNAV (GPS) RWY 5

NE-4, 06 AUG 2026 to 03 SEP 2026