

KING SALMON, ALASKA

26190

# HI-VOR Z or TACAN Z RWY 12

|                                              |                         |                                                                       |
|----------------------------------------------|-------------------------|-----------------------------------------------------------------------|
| VORTAC AKN<br><b>112.8</b><br>Chan <b>75</b> | APCH CRS<br><b>116°</b> | Rwy Idg<br>TDZE<br>Arpt Elev<br><b>8501</b><br><b>62</b><br><b>73</b> |
|----------------------------------------------|-------------------------|-----------------------------------------------------------------------|

[USAF]

KING SALMON (AKN) (PAKN)

DME required. RADAR required for procedure entry.


**▽** \* When ALS inop, increase vis to 1½ miles.  
When control tower closed, increase RVR to 50.  
**33** -31° C

MALSR




MISSED APPROACH: Climbing right turn to 3000 on heading 238° and AKN VORTAC R-210 to OLLER/15 DME and hold.

|                      |                                        |                               |                         |                              |                         |
|----------------------|----------------------------------------|-------------------------------|-------------------------|------------------------------|-------------------------|
| ATIS<br><b>128.8</b> | ANCHORAGE CENTER<br><b>124.8 354.0</b> | TOWER ★<br><b>118.3 279.5</b> | GND CON<br><b>121.9</b> | CTAF<br><b>121.90 352.05</b> | UNICOM<br><b>122.95</b> |
|----------------------|----------------------------------------|-------------------------------|-------------------------|------------------------------|-------------------------|

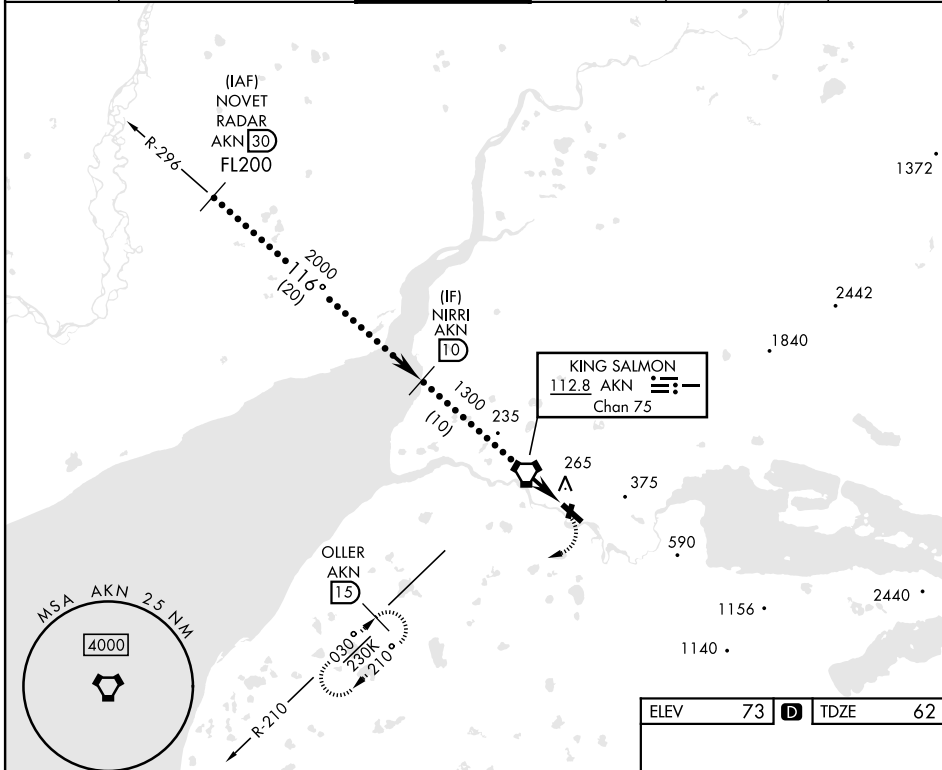

EMERG SAFE ALT 100 NM 9900

|                                                                                 |                        |                        |                      |
|---------------------------------------------------------------------------------|------------------------|------------------------|----------------------|
| NIRRI AKN (10) VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 66). |                        |                        |                      |
| 2000 116° 1300                                                                  |                        |                        |                      |
| AKN VORTAC                                                                      |                        |                        |                      |
| 3000 hdg 238° Intcp AKN R-210 OLLER AKN (15)                                    |                        |                        |                      |
| 3.02° TCH 60                                                                    |                        |                        |                      |
| 3.7 NM                                                                          |                        |                        |                      |
| CATEGORY                                                                        | C                      | D                      | E                    |
| S-12*                                                                           | 520/45                 | 458                    | (500-7½)             |
| CIRCLING                                                                        | 580-1½<br>507 (600-1½) | 900-2¾<br>827 (900-2¾) | 960-3<br>887 (900-3) |

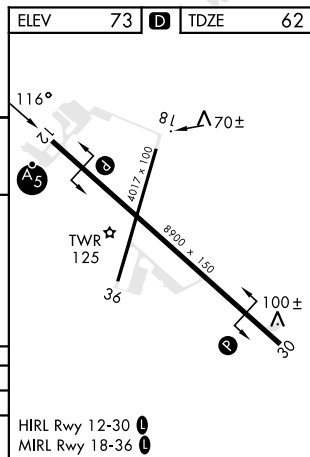

KING SALMON, ALASKA

58°41'N-156°39'W

KING SALMON (AKN) (PAKN)

Amtd 5 26DEC24

# HI-VOR Z or TACAN Z RWY 12