

LOC I-BUZ <u>111.7</u>	APP CRS 037°	Rwy Ldg 5500 TDZE 904 Apt Elev 904
----------------------------------	------------------------	---

ILS or LOC RWY 4
BOLTON FLD (TZR)

ADF required.
RADAR required for procedure entry.


T AutoPilot coupled approach NA below 1144.

MALSR



MISSED APPROACH: Climb to 1400 then climbing right turn to 2700 direct BU LOM and hold.

AWOS-3PT 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER ★ 128.1 (CTAF) 0	GND CON 121.8
----------------------------	--	---	-------------------------

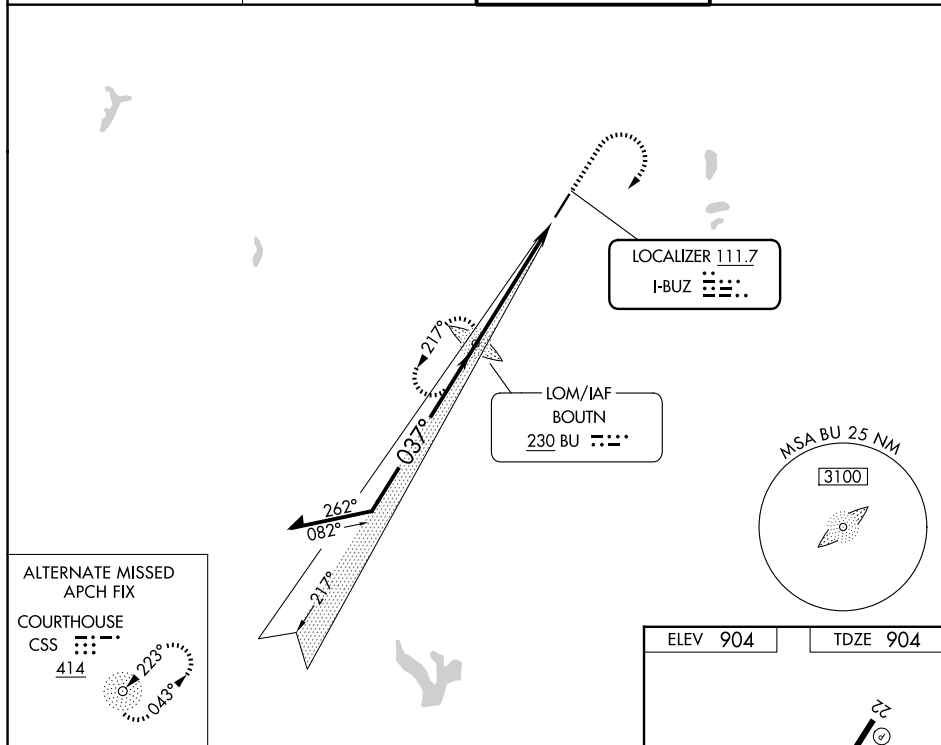

EC-2, 06 AUG 2026 to 03 SEP 2026

Remain within 10 NM

BU LOM 2682

2700 217°

2700 037°

GS 3.00°
TCH 41

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 25).

5.4 NM

CATEGORY	A	B	C	D
S-ILS 4		1104-½	200 [200-½]	
S-LOC 4	1360-½ 456 (500-½)		1360-¾ 456 (500-¾)	1360-1 456 (500-1)
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

TWR ✈

5500 x 100

037°

REIL Rwy 22 Ⓛ
MIRL Rwy 4-22 Ⓛ

FAF to MAP 5.4 NM

Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48

COLUMBUS, OHIO
Amdt 5B 05DEC19

39°54'N-83°08'W

BOLTON FLD (TZR)

ILS or LOC RWY 4

EC-2, 06 AUG 2026 to 03 SEP 2026